

Dt: 26-06-2024.

To

MD Sir

Sub: Crescentia and NRK cable laid - MN park premises Pending Works Inspection report - Reg.,

As per your instructions, Yesterday Inspected the works cable laid at M N Park premises along with Mr. Satyanarayana, AVP, Neovantage, Electrical Contractor Venu Babu and Mr. Ramesh reddy, Project Manager, MEP.


The following works are pending as per physical verification. The Neovantage management asking to complete works. Satyanarayana saying after completion the said works his HOD will inspect again then they will consider to release security deposit based on the performance of works.


As per joint inspection done with Mr. Satyanarayana (MN Park) dated 25-06-2024, following observations have been noted and need to be attended from our side.


- 1) Debris which was excavated at the time of road crossing have to be removed.
- 2) 11KV cable route markers have to be placed for every 3m has sign of identification.
- 3) At the entrance of MN park, along the cable routing landscaping has been disturbed. We need to rearrange the same.
- 4) Our Cable @ RMU which is in vertical position has to be dressed and it should be enclosed in shaft like thing by covering it with GI sheets.
- 5) Wherever excavation was not possible cable was laid on the original ground. So for this length trench has to be constructed with precast on top. Approximately length of the trench is 70mtr.
- 6) Hoarding board belongs to MN park has to be refabricated which is at the entrance of GV1.
- 7) 18 nos of Rain water eco drain pipes at different locations, each of 3m length has to be laid in footpath.
- 8) Damaged Kerb stones have to be repaired and painted.
- 9) Damaged STP line at GV1 has to be replaced. Approximately 30 m of 50 dia HDPE line has to be relayed.
- 10) During back filling, Street light cable was not buried and it is lying on foot path, it has to be buried at a depth of 6".
- 11) Road at the entrance of MN park substation which is near GV1 has to be relaid. 20 to 25 Sqm road has to be laid.

Sitaram




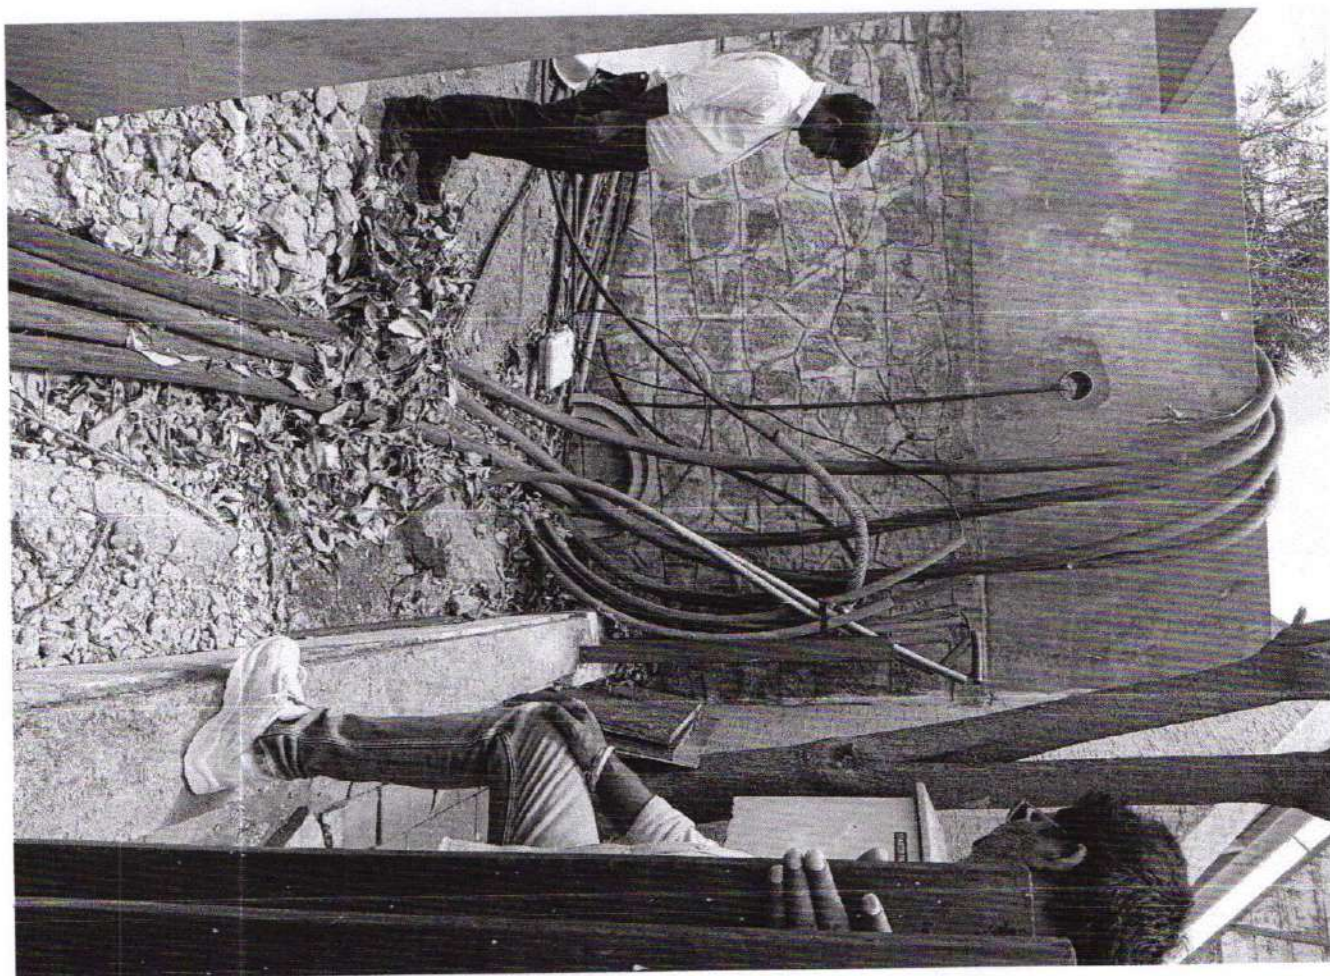

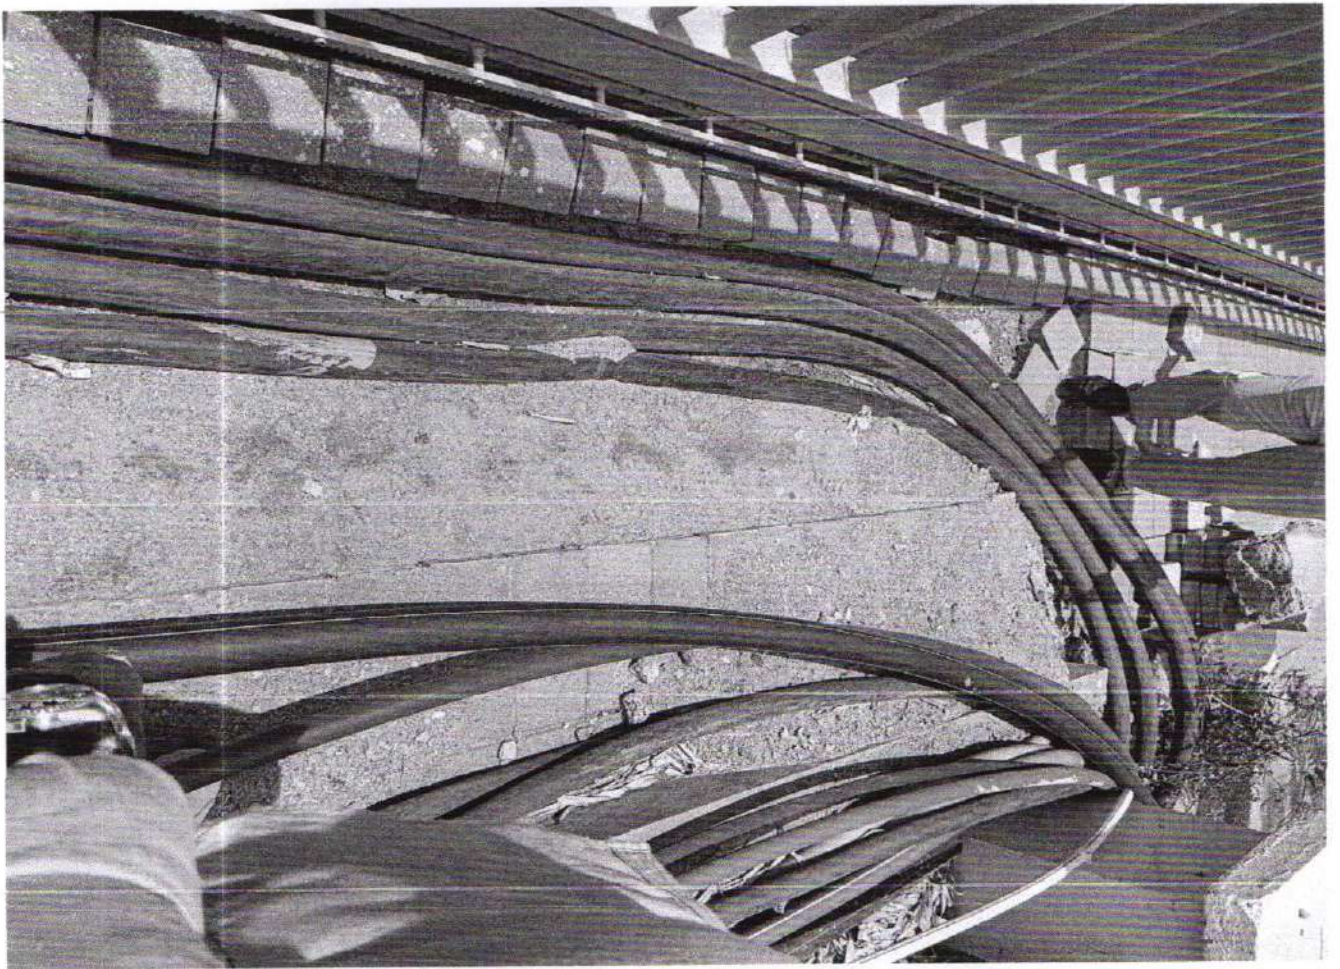

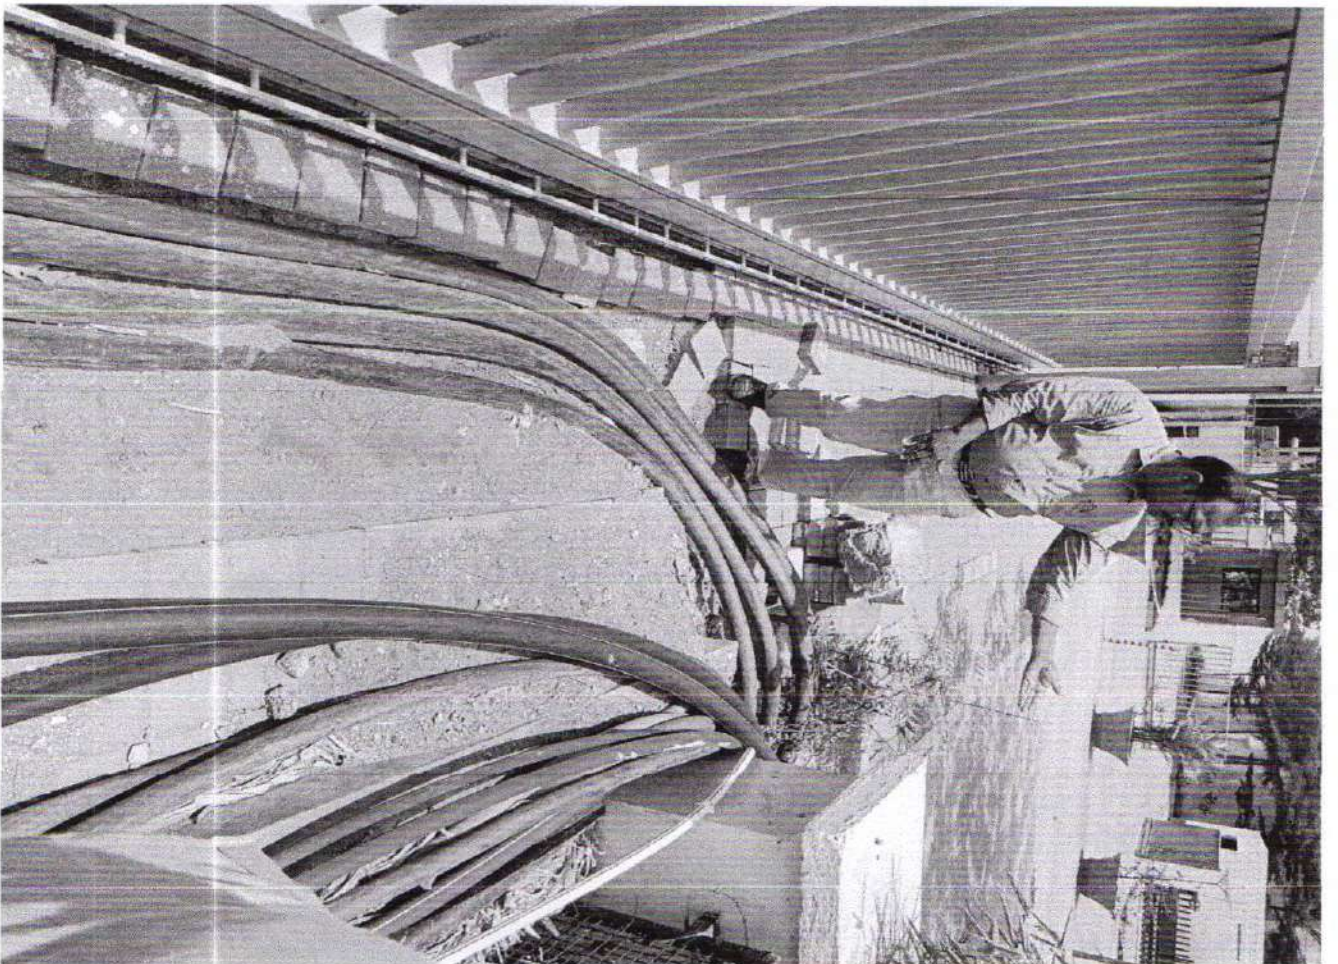



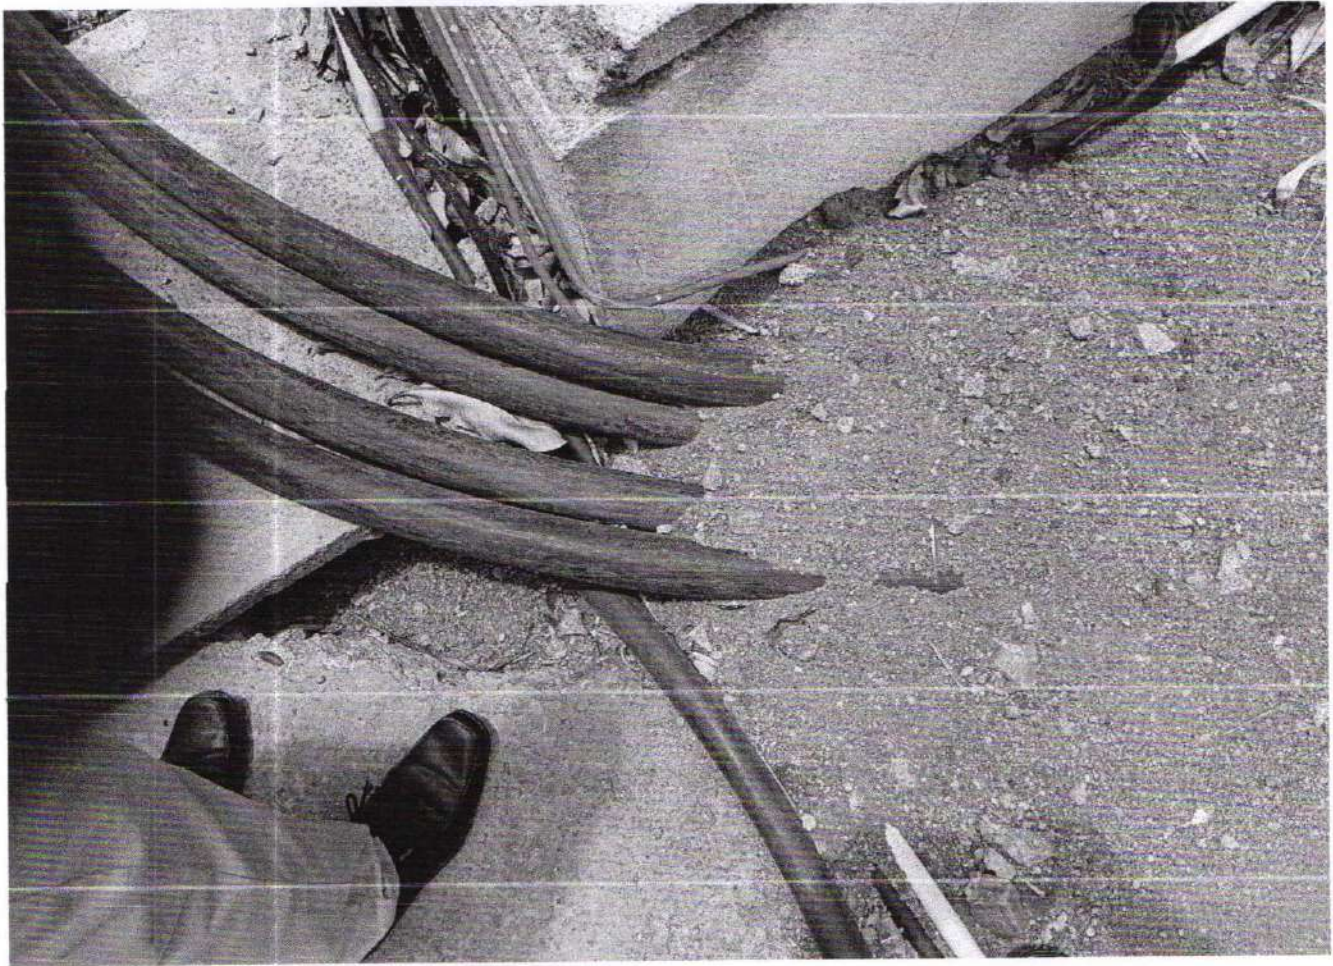













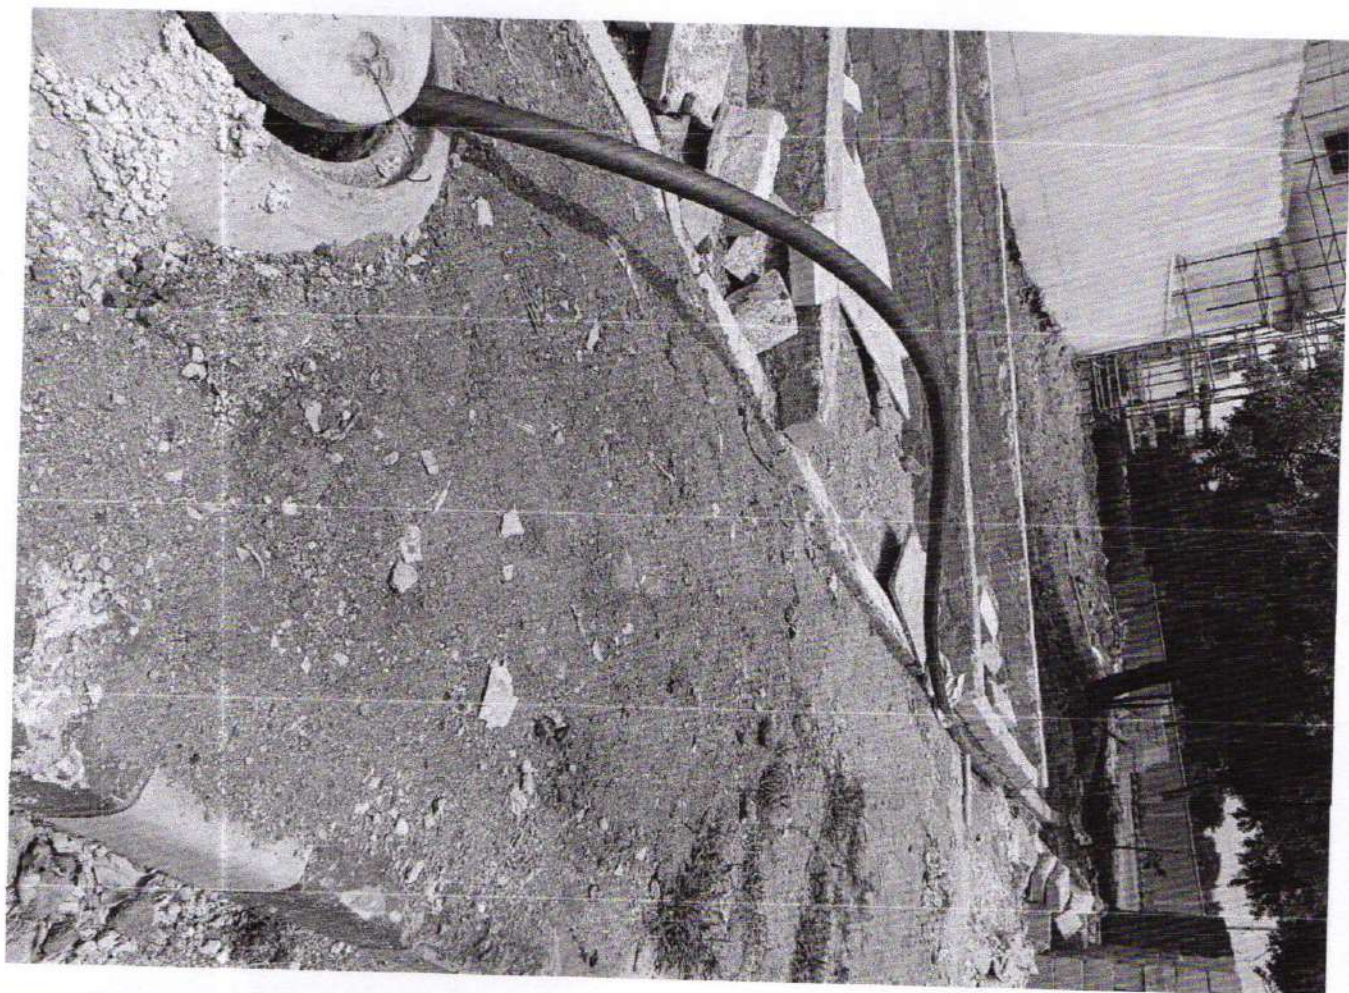






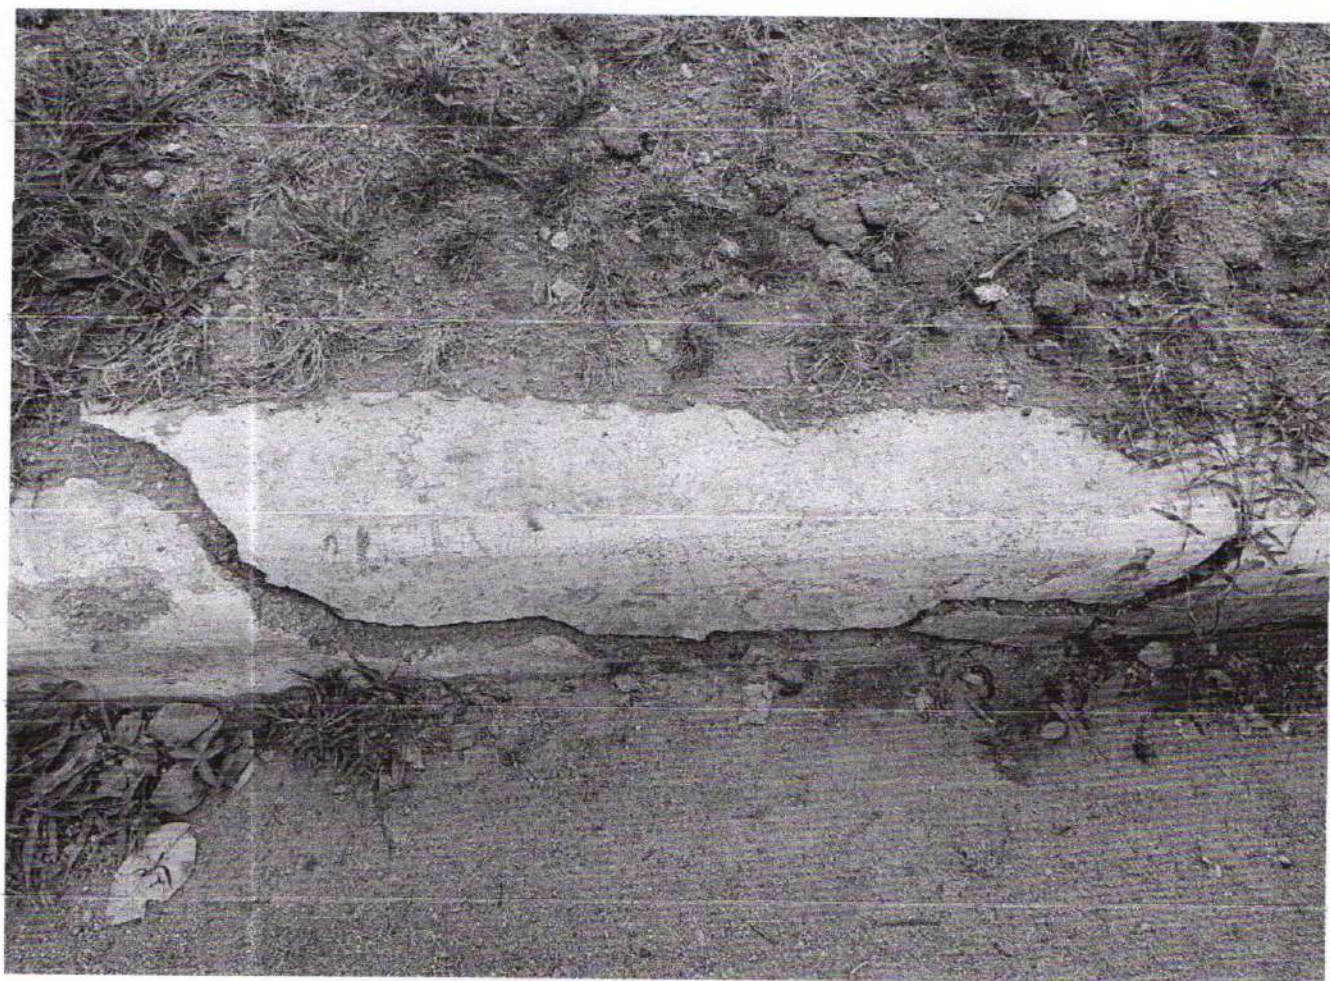

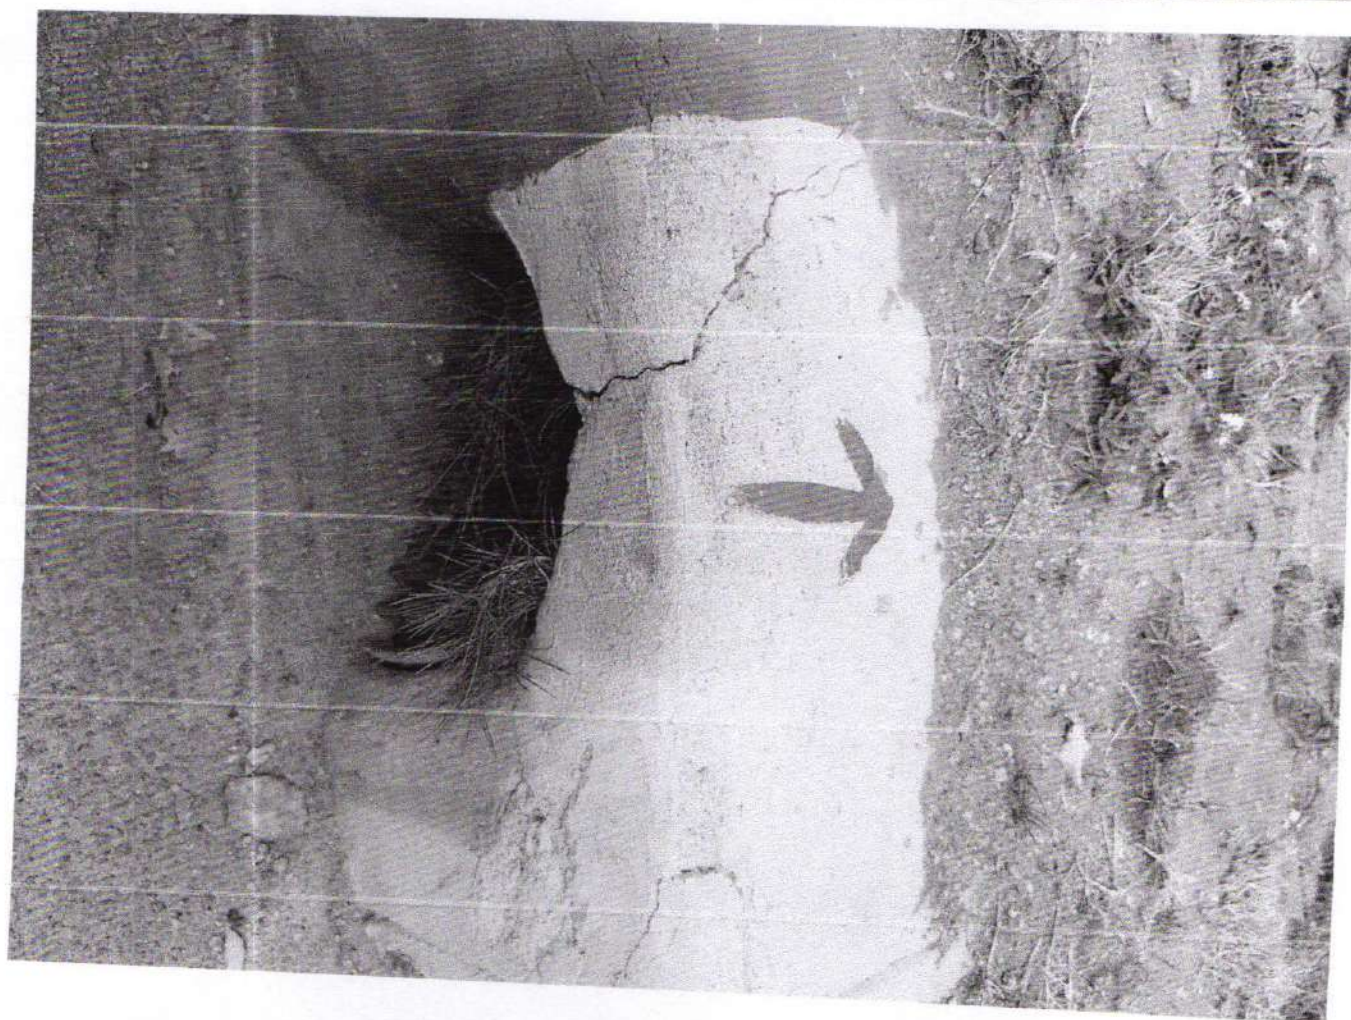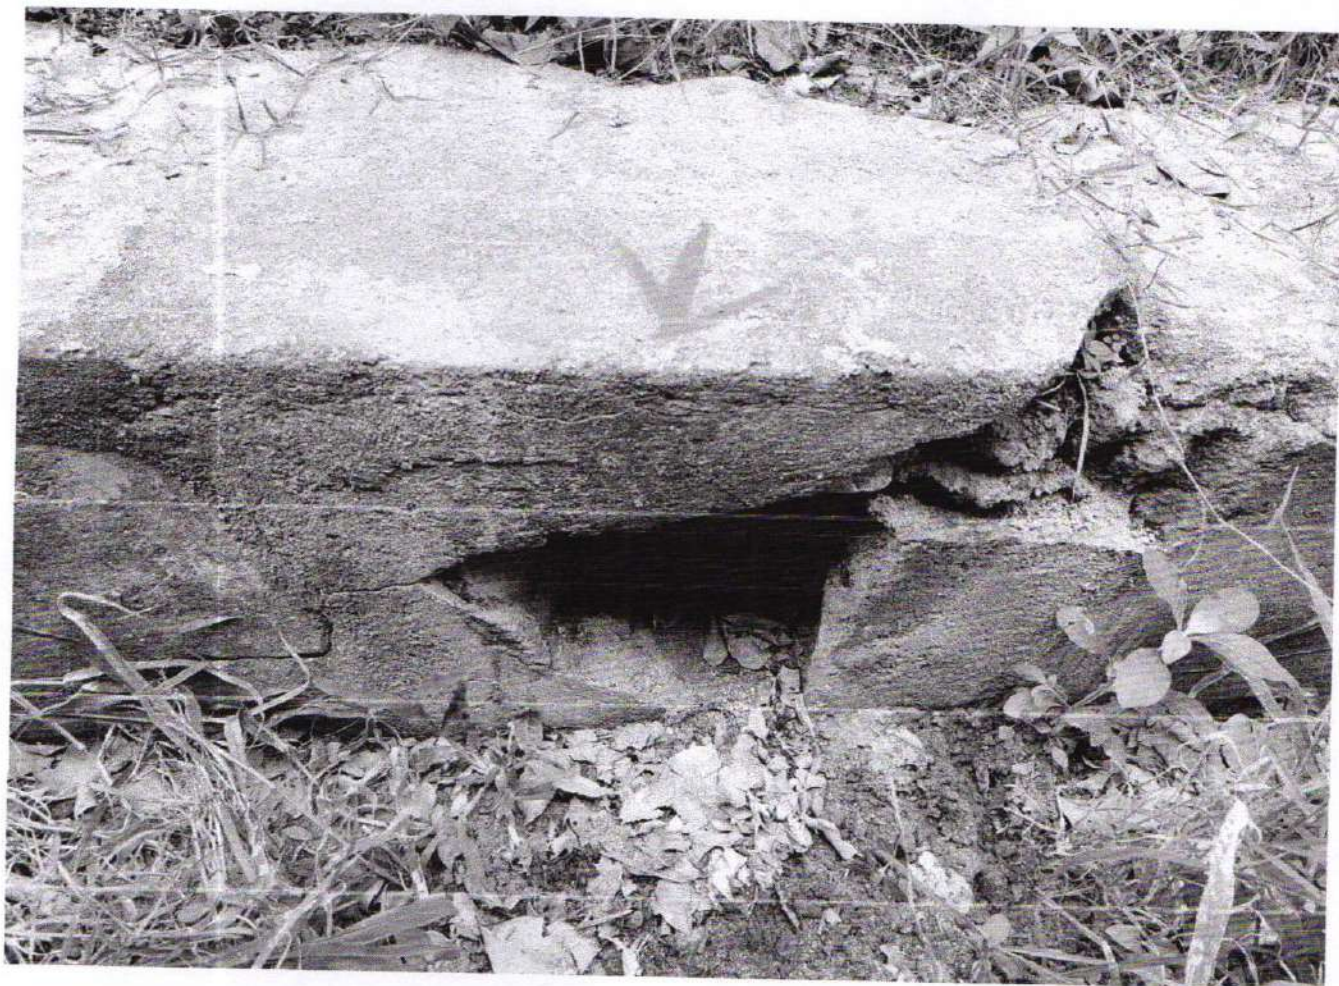





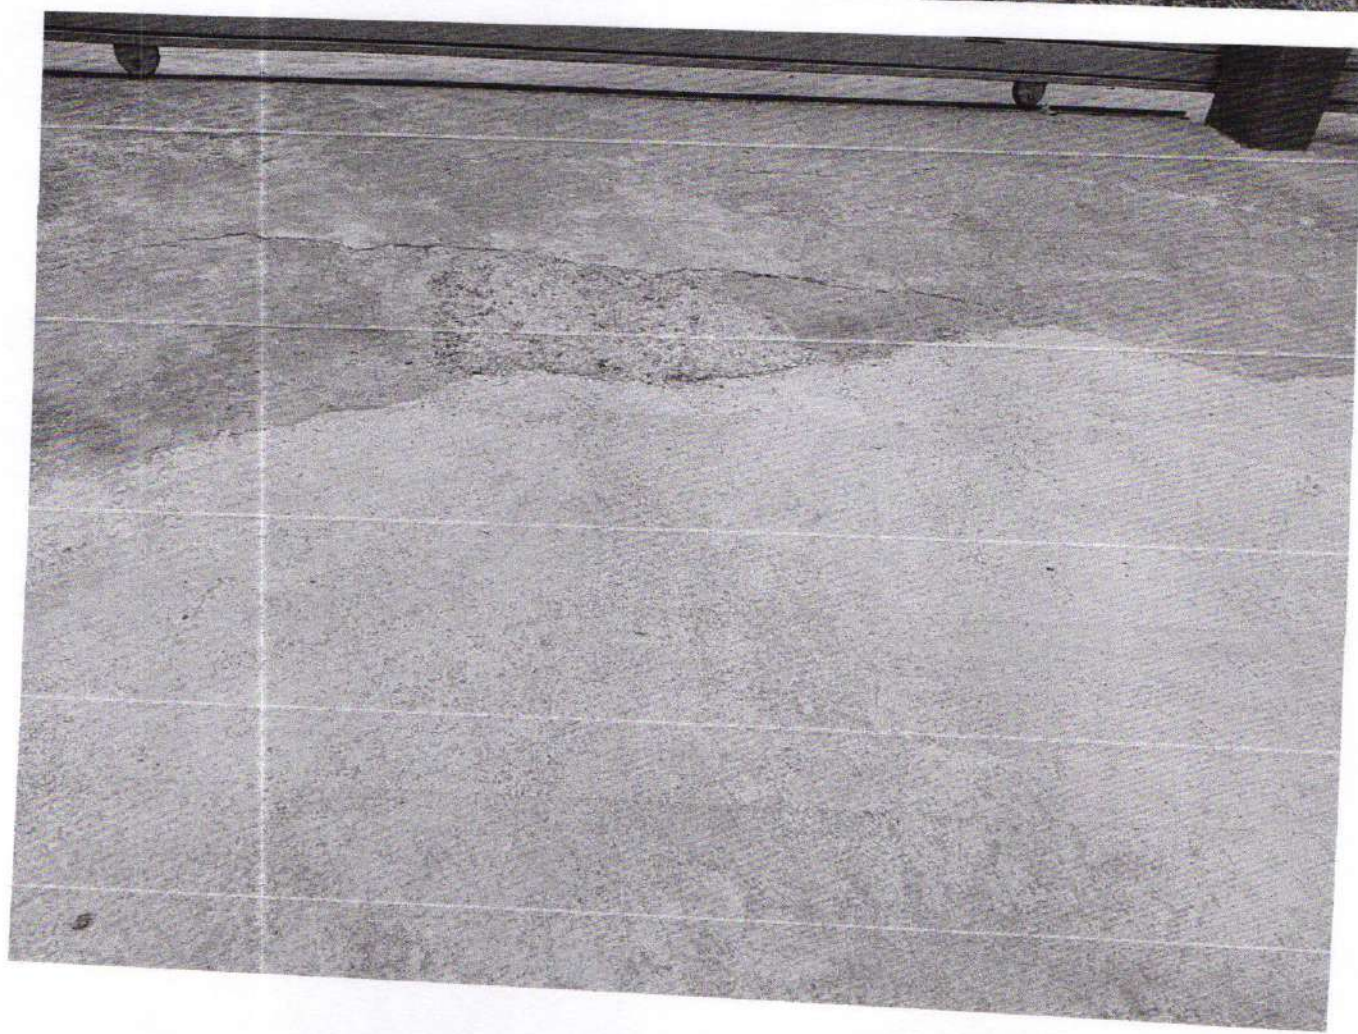






Slotted hole Home pipe damaged

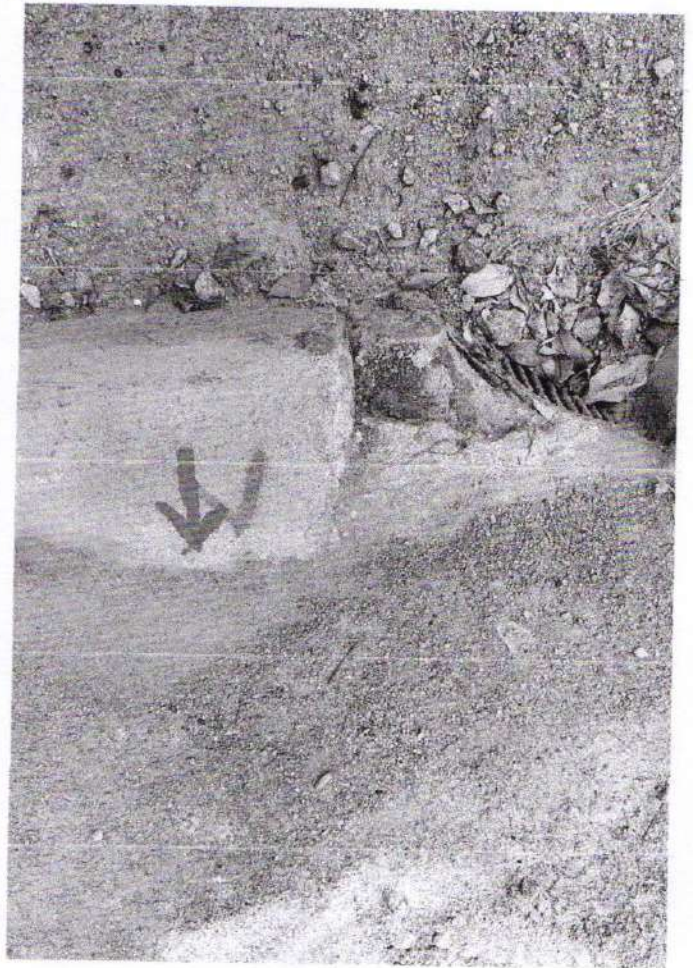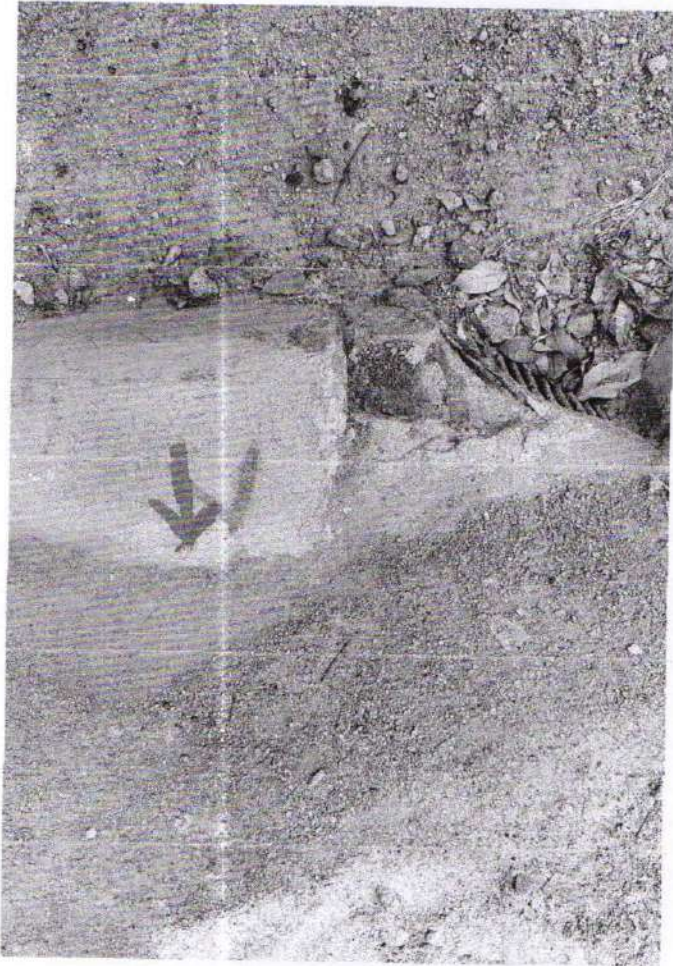


Street light wored not
loose kept on ground



Home pipe damaged

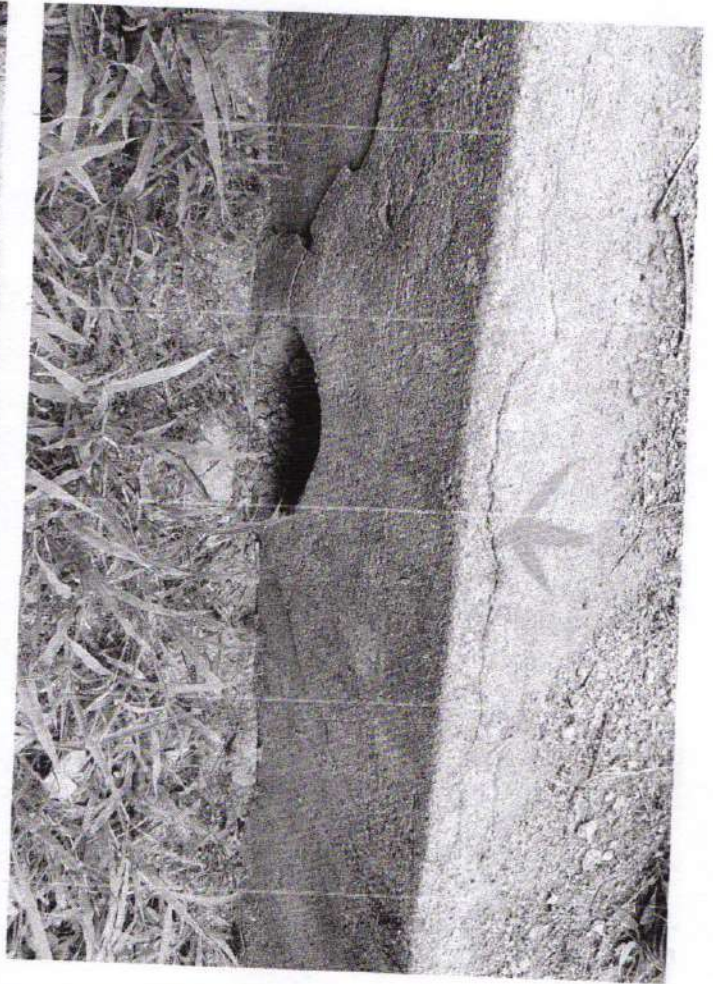



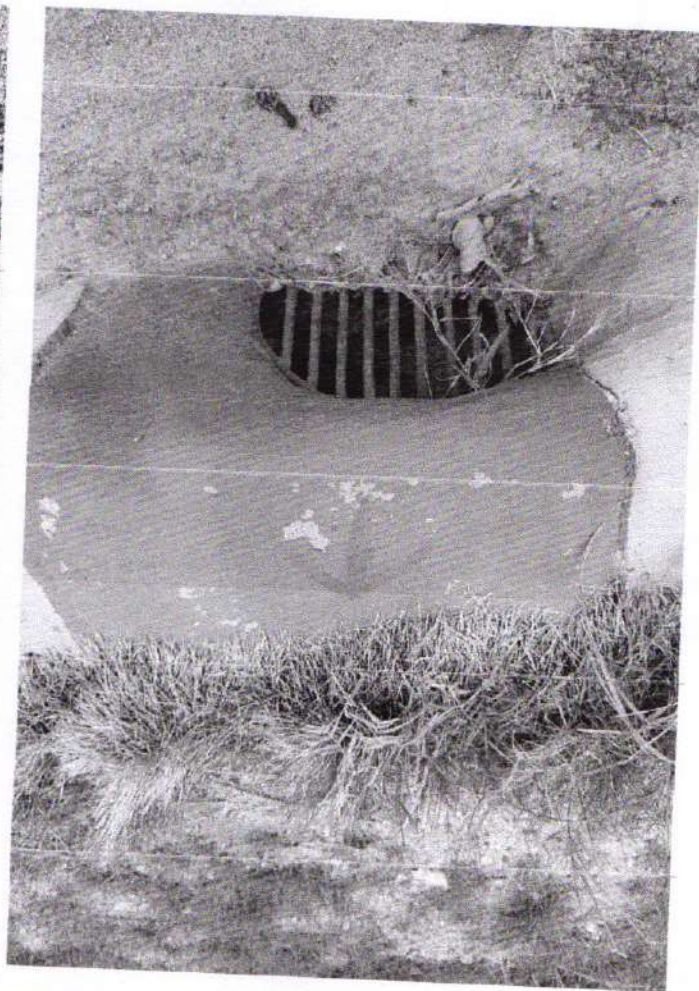

Storm water Humapores damaged.