

Construction Division
Additions & Alteration Charges Approval Form

Company Name:	Modi Properties Pvt Ltd	Site	May Flower Platinum
Name of the customer	Mrs. K. Karunastee / Mr. P. R. Venkat T Rao.		
Villa/ Flat No.	C - 401		
Sl.No	Description	Amount	
1	Total extra Charges	5,520 = 00	
2	Total refundable amount	-	
3	Net amount to be charges (if any)	5,520 = 00	
4	Net amount to be refunded (if any)	-	
Remarks :			
Approved by Project Manager		Approved by Design Team	
Date		Date	
Sign:		Sign:	

Note: 1. Enclose measurement & estimate sheet. 2. Send scanned copy by email to plans@modiproperties.com & CR. 3. Maintain originals in A&A of customers at site.

MEASUREMENT SHEET													
Company Name:		MPL											
Project:		May Flower Platinum											
Work Description:		Extra Specs											
Flat No.		C-401											
Prepared By		K. Narender Reddy											
Date:		25-10-2022											
S No.	Item Head	Item Description					Length	Width	Height	Nos.	Quantity	Units	Item Head Total
	Extra Charges												
1	UPVC Window	Mesh Provision for windows					5.00	1.00	4.00	4.00	80.00	sft	
							4.00	1.00	3.00	1.00	12.00	sft	92.00

Tiling & granite work		Rate the quality of (Good ✓, Avg. X, Poor – needs correction XX, NA)												
S No	Room	Workmanship of tiling	White cement filling around CPVC lines	Corners finishing	Finishing near doors	Finishing on top of tiles	Finishing near ventilators	Step at bathroom entrance / utility	Step for shower / pot wash	Tile joint grouting	Granite platform finishing and edge polishing	Granite platform slope	Granite platform height	Finishing under granite platform
1	Toilet 1 M.T	✓	✓	✓	✓	✓	✓	✓	X	✓	✓	✓	✓	✓
2	Toilet 2 G.T	✓	✓	✓	✓	✓	✓	✓	X	✓	✓	✓	✓	✓
3	Toilet 3 C.T	✓	✓	✓	✓	✓	X	✓	✓	✓	✓	✓	✓	✓
4	Toilet 4	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
5	Wash basin in dining area	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Kitchen	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Utility	✓	✓	✓	✓	✓	✓	X	✓	✓	✓	✓	✓	✓
8	Other													
9	Other													
Remarks		1) Some tiles were not placed in C-Toi												
		2) provision for modular kitchen												

Quality Control Check Repot. Stage: After Finishing Stage II (Apartments)

S No	Room	Rate the quality of (Good ✓, Avg. X, Poor - needs correction X X, NA)										Edge building
		Flooring workman ship & grouting	Skirting size (3")	Skirting workmanship	Plastering above skirting	Plastering & finishing of walls	Crack filling	Loft Finishing	Windows check	General quality of painting & finishing	Door & frame painting quality	Door beading, luppam and painting quality.
1	Bedroom 1 M.B	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
2	Bedroom 2 K.B	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
3	Bedroom 3 G.B	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
4	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
5	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Lobby 1- Pool's a	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Utility / balcony 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Utility / balcony 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
9	Utility / balcony 3-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
10	Kitchen	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
11	Other - Store											
12	Other											
Remarks		1) Finishing near door C. Bed and seepage was appeared in C-Bed.										
		2) Finishing floor store room shelf was not done										

Quality Control Check Report. Stage: After Plumbing & Electrical (Apartments)

Flat No.	C-401	Other	SI. No.	37723
Company	MPL	Project	Phase	-
Prepared by	T. Vinod Kumar	Sign	Date	05-06-21
Project Manager	Subba Reddy	Sign	Date	05-06-21
Previous stage report no.	37009	Report filed and signed by PM?	Yes ☒ No ☐	
Additions & alterations sheet date	19/12/20	All pages signed by engineer & customer?	Yes ☒ No ☐	
Checked By MD on	MD Sign	For filling	Yes ☐ No ☐	

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
- ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
- ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
- ☐ Proceed with further work. ATR not required.

Inspection should be done after:

- after cleaning the apartment.
- before starting painting, tiling & flooring.
- electrical conduct, waterproofing & plumbing work is completed (for stage II only).
- additions & alterations is finalized and signed. In case there are no additions and alterations printout of email by PM to CR confirming the same must be filed.
- additions & alterations sheets to be transferred to QC file. QC to check if A&A are made as per request.

Certified that all corrections mentioned in the QC report have been completed. Work can proceed to next stage.

After Plumbing & Electrical Check.

Notes:

1. Mark ☒ for correct or minor mistake which does not require correction
2. Mark ☒ for minor mistake that requires minor correction.
3. Mark ☒ for major mistake that requires correction by replacement or re-fixing.
4. Mark ☒ for major mistake that cannot be corrected.
5. Location of CPVC & PVC fittings must be checked as per measurements given in circular. Tolerance 1".
6. Location, height and spirit level of electrical points must be checked as per measurements given in circular & plan. Tolerance 1".
7. Civil work near pipes in balcony & utility must be neat and mortar should be removed from the pipes.
8. Water proofing must cover all pipes & check height above SFL.
9. Fasteners must be used as specified in circular. Especially check fixing of PVC pipes.
10. Height of DB box must be 6" below false ceiling level or 12" below slab level.
11. In case of many changes in civil work, electrical work and plumbing work, a new drawing must be prepared at HO and approved by MD.

Project in-charge	Sign	Date
<i>[Signature]</i>	22/6/2021	

Quality Control Check Report. Stage: After Plastering (Apartments)

Flat No.	C-401	Other	Sl. No.	37009
Company	MPL	Project	Phase	-
Prepared by	T. Vinod Kumar	Sign	Date	02-02-21
Project Manager	Subba Reddy	Sign	Date	02-02-21
Previous stage report no.	36775	Report filed and signed by PM?	yes	
Checked By MD on		MD Sign	For filling	☐ Yes ☐ No

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
- ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
- ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
- ☐ Proceed with further work. ATR not required.

Inspection should be done after:

- brickwork & 2 coats plastering is completed
- after cleaning the villa.
- Water proofing, screeding in bathrooms is completed.
- before starting painting, tiling & flooring.

Plastering Check.

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. 9" unplastered area from SFL should be left including in common areas and terraces.
6. Windows must be checked with templates. Plastering must be 3mm margin for lippum work. Tolerance 1/4".
7. Provision of tiles in bathrooms, kitchen & wash areas (rough plastering).
8. Check size of sink bowl. Hole should be 1" to 2" larger. (Tolerance: 1")
9. All doors frames should have 1/2" grooves.
10. Sill top must me of uniform thickness, correct height, at one level & without broken edges.

Certified that all corrections mentioned in the QC report have been completed. Work can proceed to next stage.

Project in-charge	Sign	Date
<i>[Signature]</i>		03/02/2021

Quality Control Check Report. Stage: After Plastering (Apartments)

S No	Room	Skirting Provision (✓ or X)	Furnishing around door frame (✓ or X)	Beams & columns finishing (✓ or X)	Finishing of lofts (✓ or X)	Electricity junctions finishing (✓ or X)	Windows check (✓ or X)	Tiles provision (✓ or X)	Sink provision & size (✓ or X)	Grooves for door frames (✓ or X)	Balcony & terrace sill top finishing (✓ or X)	Screeding in bathroom & utility (✓ or X)	Screeding in 6" above FFL? (✓ or X)
1	Bedroom 1- M. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
2	Toilet 1 M. Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
3	Bedroom 2- C. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
4	Toilet 2- C. Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
5	Bedroom 3- G. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Toilet 3-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Bedroom 4-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Toilet 4-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
9	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
10	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
11	Lobby 1- Puja	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
12	Lobby 2- Utility	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
13	Terrace/ balcony	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
14	Terrace/ balcony 2-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
15	Terrace/ balcony 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
16	Portico	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
17	Kitchen	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
18	Other	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Remarks													

Quality Control Check Report. Stage: After Brickwork (Appts)

Flat No.	C-401	Others	SI. No.	36775
Company	MPL	Project	Phase	-
Prepared by	T. Vinod Kumar	Sign	Date	30-12-20
Project Manager	Subba Reddy	Sign	Date	30-12-20
Previous Stage report no.	36256	Report filed and signed by PM?	yes	
Apartment No.	Other	other		
Checked By MD on	MD Sign	For filling	☐ Yes ☐ No	

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
- ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
- ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
- ☐ Proceed with further work. ATR not required.

Inspection should be done after:

- brickwork is completed
- chicken mesh fixed
- after cleaning the apartment
- electrical conducting work is completed

Brickwork Check.

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. Wall thickness should be as per plan. Use of 4", 6" & 8" blocks must be checked.
6. All walls should have 2 beds of about 2" to 3" thickness with one no. 6 mm or 8 mm rod with M15 CC.
7. Chicken mesh should be used in each and every joint between RCC & Brickwork.
8. Joint between brickwork & beam on external side must be filled.
9. Check room dimensions with working plan. (Tolerance: 1")
10. Diagonals of each room shall be equal. (Tolerance: 2")
11. Balcony sill level should be 3'3" from SFL. (Tolerance: 1")
12. Check room height with specified height. (Tolerance: 1")
13. Check plumb of walls wherever it appears to be out of plumb. (Tolerance: 1/2")
14. Specify the No. of beams which are not aligned by more than 1" in a room.
15. Door frames must have black Japan coating and wood primer / pellambar - at cost of painter.

Certified that all corrections mentioned in the QC report have been completed. Work can proceed to next stage.

Project in-charge	Sign	Date
<i>[Signature]</i>		31/12/20

Quality Control Check Report

Stage: After Brickwork (Apartment)

S No	Room	Wall thickness (✓ or ✗)	Beds in walls (✓ or ✗)	Chicken mesh (✓ or ✗)	External brickwork & beam joint (✓ or ✗)	Room Dimensions (✓ or ✗)	Room Dimensions (✓ or ✗)	Difference in inches	Diagonal (✓ or ✗)	Diagonal Difference in inches	Balcony sill level (✓ or ✗)	Room Height (✓ or ✗)	Plumb of walls (Good/Avg./Bad)	Alignment of beams and walls - Nos.
1	Bedroom 1 - M. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	avg	✓
2	Toilet 1 - M. Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	"	✓
3	Bedroom 2 - C. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	"	✓
4	Toilet 2 - C. Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	"	✓
5	Bedroom 3 - G. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	"	✓
6	Toilet 3 -	-	-	-	-	-	-	-	-	-	-	-	-	-
7	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Good	✓
8	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	"	✓
9	Lobby 1 - Puja	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	"	✓
10	Utility / balcony 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	"	✓
11	Utility / balcony 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	"	✓
12	Utility / balcony 3	-	-	-	-	-	-	-	-	-	-	-	-	-
13	Kitchen	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Good	✓
14	Other													
15	Other													
Remarks														

Quality Control Check Report. Stage: After Brickwork (Apartments)

Quality of edges and corners in all rooms?	☐ Good ☒ Avg. ☐ Bad
Specify rooms that need correction:	

Misc. Checks.	
Was 3.75 CFT proportion box provided?	☒ Yes ☐ No
Condition of proportion box?	☐ Good ☒ Avg. ☐ Bad
Was the Apartment cleaned before starting brick work?	☐ Yes ☐ No ☒ Cant' say
Is the Apartment cleaned for plastering?	☒ Yes ☐ No
Wastage?	☐ High ☒ Medium ☐ Low
Storage of building material like bricks sand and cement.	☐ Good ☒ Avg. ☐ Bad
Drum (200 ltrs) provided for curing in each flat?	☐ Yes ☐ No ☐ —
Remarks:	

Door Frames & Windows check

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. Window template depth should be between 2 to 2 ½" after plastering.
6. Lintel level should be 7'3" from SFL & 7' from FFL. (Tolerance 1")
7. Lofts should be at a height of 7' to 7'3" from FFL. Kitchen plat form thickness should be 2", SFL to bottom 3 1" .. (Tolerance 1")
8. Slopes of lofts and kitchen platforms to be checked by using 12" spirit level and check height from floor from 2 or 3 points.
9. Thickness of platforms & lofts should be between 2 & 2.5".
10. Provide single layer table brick at bottom of each door frame without threshold.
11. Check Z angle template size.
12. Window opening must be checked with MS square pipe templates of 2 sizes for inner and outer openings.
13. Z angle template must be 1" from brick wall surface from the inner side.

Quality Control Check Report. Stage: After Brickwork (Apartments)

S No	Room	Door size, face and position (✓ or X)	Brick at bottom of door frame (✓ or X)	Door lintel level (✓ or X)	Door diagonal check (✓ or X)	Door Plumb - two sides (✓ or X)	Windows lintel & sill level (✓ or X)	Windows size (✓ or X)	Windows - template depth & diagonal (✓ or X)	Windows - template red oxide painting (✓ or X)	Loft & Kitchen platform height (✓ or X)	Loft & Kitchen platform slope (✓ or X)	Door size, face and position (✓ or X)
1	Bedroom + M. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
2	Toilet + M. Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
3	Bedroom + C. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
4	Toilet 2 - C. Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
5	Bedroom 3 - G. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Toilet 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
9	Lobby + Puja	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
10	Utility / balcony 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
11	Utility / balcony 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
12	Utility / balcony 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
13	Kitchen	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
14	Other	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
15	Other	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Remarks: Note:- Brick at the bottom for door frames not provided as 3/4" patti is provided as per M.D sir approval.													

MAYFLOWER PLATINUM

Survey no. 82/1, Mallapur, Hyderabad – 500 076.
Owned & Developed by: M/s. Modi Properties Pvt. Ltd.
Head office; 5-4-187/3&4 M G Road Secunderabad.

Details of Additions & Alterations

Flat No	401	Block	'C' ✓
Flat Area	1500 sft	Type	Deluxe / Luxury
Buyer Name	Mrs.K Karunasree/Mr.P.R.Venkat T Rao		
Phone No.	9391029842/7680000439	Email	karuna.shree@gmail.com

I hereby confirm that I have given the details of the minor additions and alterations that are required in the above referred flat in the pages attached herein. Please complete the changes suggested by me. I agree to pay the charges, if any, for the additions and alterations that I have asked you to make, as per the rates suggested by you. I shall deliver all the materials that are required to be provided by me at the site on or before _____. In case I fail to deliver these items to the site by the specified date, you may complete the works in the flat as per the standard items provided by you.

Buyers sign	K. Karunasree	Engg. Sign	K. Karunasree
Date:	19/12/2020	Date	19/12/2020

Note:

1. Colour shades of paints may vary from batch to batch & company to company. The Builder will not take responsibility of quality of work for dark shades especially green & blue.
2. Shade / colour of natural material like marble and granite can't be guaranteed and may vary from lot to lot. Cracks like appearance in marble is a natural feature and Builder shall not be responsible for repairs or replacement.
3. Availability of bathroom or flooring tiles of the same type /colour/make can not be guaranteed and closest possible type/colour/make may be used in its place.
4. No further change shall be permitted from this day.
5. Please sign on all pages.

Buyers sign:

Engg. Sign:

Date:

K. Karunasree

K. Karunasree

19/12/2020

Choice of colours:

① Same as A-105

Changes in flooring:

① All rooms 2'0" x 2'0"

② Kitchen same as A-105

Buyers sign:

L. Kaurana

Engg. Sign.

phw

Date:

17/12/20

Changes in electrical points: (mark on plan)

① Marked on plan

Choice of Bathroom tiles, CP fittings & Sanitary ware:

① Same as A-105


Buyers sign:

K. Karim

Engg. Sign:

K. Karim


Date: 17/12/2022

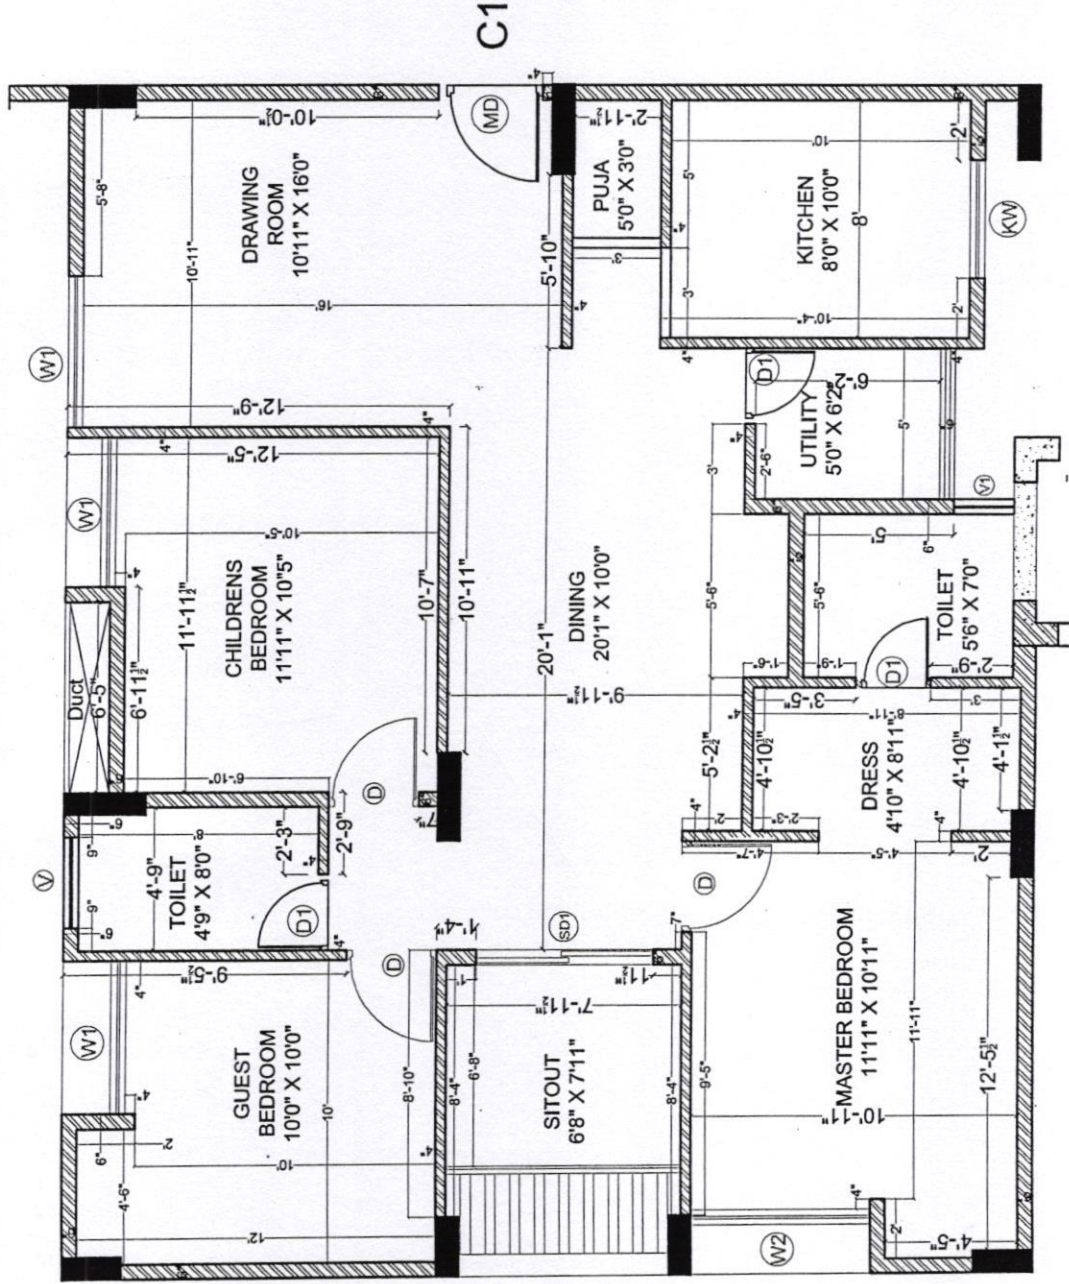

K. Karmajee

K

Description	Direction	Owners & Developers :	Date :	Promoted by
WORKING DRAWING OF FLAT.NO. C-1	N	Modi Properties Pvt Ltd.	18.08.2020	
		Project Name & Phase :	Prepared By :	Modi Properties Pvt. Ltd
		MAYFLOWR PLATINUM	Approved By : Scale :	Phone:+91-40-66335551 N.T.S

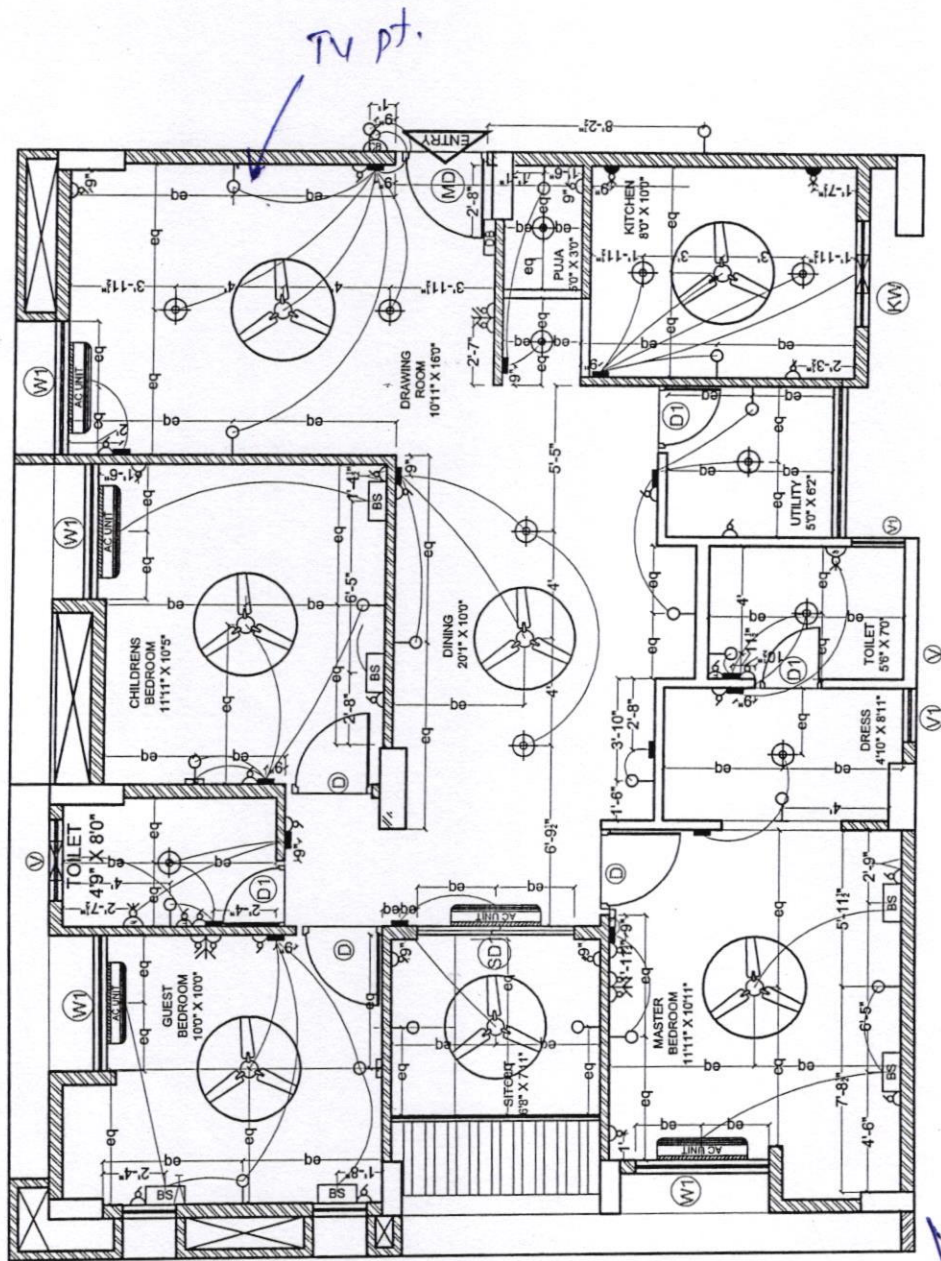

ELECTRICAL LEGEND		
SYMBOL	DESCRIPTION	MOUNTING HT.
	5 amp outlet with switch on raw power	3'-6" from FFL
	Geyser Point	8'-3" from FFL
	15 amp outlet with switch on raw power (or fridge)	below counter
	Wall light	6'-6" from FFL
	Ceiling fan	ceiling ht
	TV point	3'-6" from FFL
	Telephone point	3'-6" from FFL
	LAN / Ethernet	3'-6" from FFL
	Ceiling light	ceiling ht
	Switch board	4'-6" from FFL
	Bed Side Switch board	2'-0" from FFL
	Distribution board	5'-6" from FFL
	Exhaust point	7'-6" from FFL
	AC Point	8'-0" from FFL
	AC Unit	as per standard
	Calling bell switch	4'-6" from FFL
	Calling bell	8'-0" from FFL
	Exhaust	7'-0" from FFL

Description

ELECTRICAL PLAN OF FLAT-CI

Direction Owners & Developers :



BNC Estates

Project Name & Phase :

Mayflower Grande

Date :

18.08.2020

Prepared By :


Soham Modi

Approved By :

N.T.S

Promoted by

Modi Properties & Investments Pvt. Ltd.
Phone: +91-40-6633551

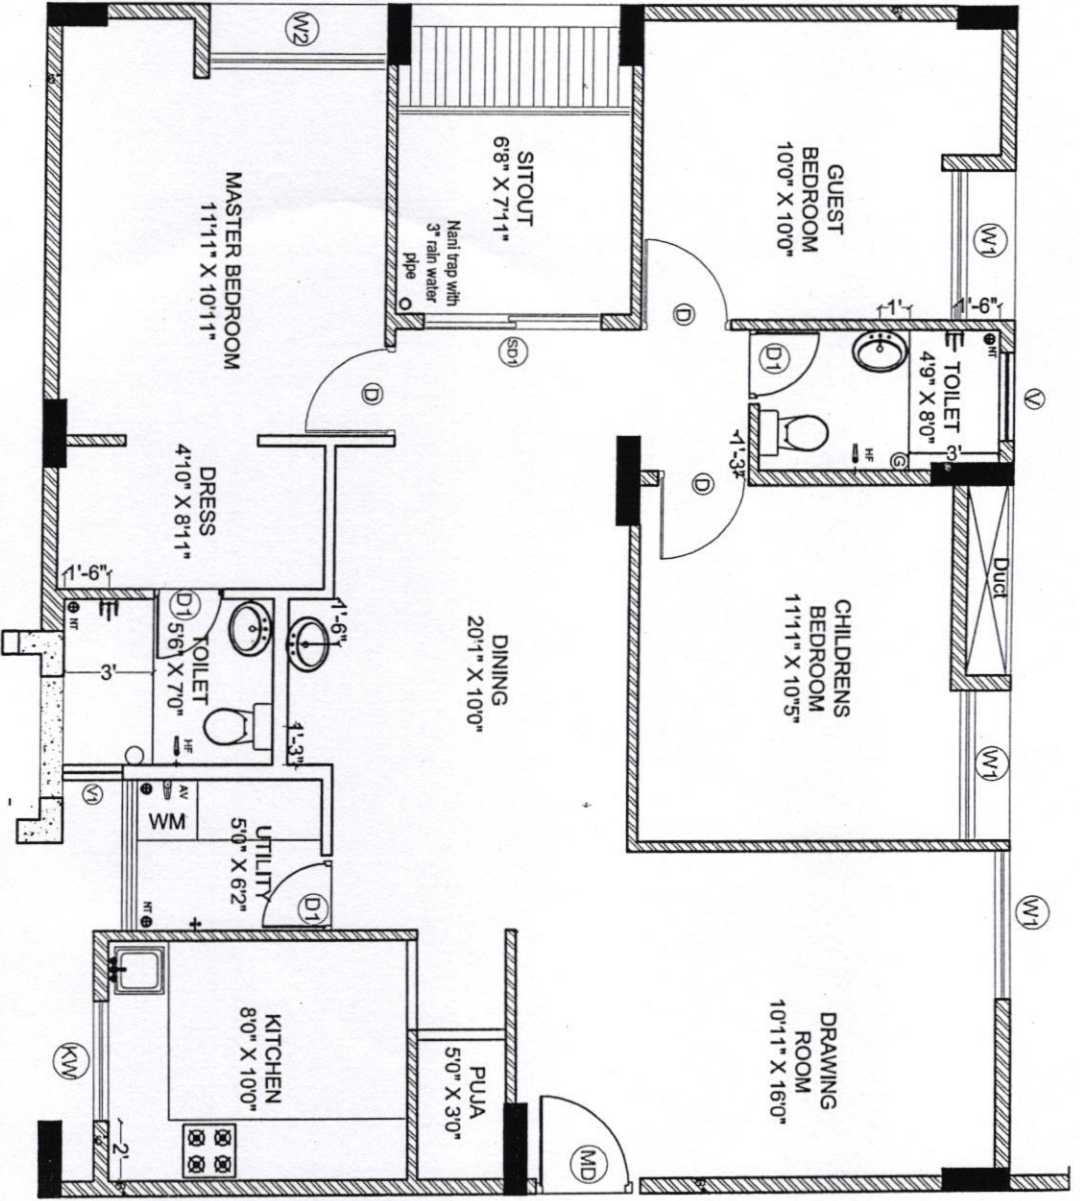

C1

[Handwritten signature]

+	HEALTH FAUCET
⊥	ANGLE VALVE
⊙	RAIN TRAP
○	3" RAIN WATER PIPE
⊙	GEASER POINT
⊥	WALL MIXTURE
+	TAP / LONG BODY

LEGEND

Description

Direction

Owners & Developers :

Date :

18.08.2020

Promoted by

PLUMBING PLAN OF FLAT NO. C-1



Modi Properties Pvt Ltd.
Project Name & Phase :
MAYFLOWR PLATINUM

Prepared By :
Approved By :
Scale :

18.08.2020

Modi Properties Pvt. Ltd
Phone:+91-40-66335551

Soham Modi
N.T.S