

Quality Control Check Report. Stage: After Brickwork (Apartments/ Lab Spaces)

Flat No.	A-116	Others		Sl. No.	41746
Company	M R G V	Project	B R G V	Phase	-
Prepared by	P-Bharath	Sign	P-B	Date	29-04-23
Project Manager	Sowmya Abishek	Sign	Abishek	Date	29-04-23
Previous Stage report no.	41000	Report filed and signed by PM?		☒ Yes ☐ No	
Apartment No.		Other		other	
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
☐ Proceed with further work. ATR not required.

Inspection should be done after:

- brickwork is completed
- chicken mesh fixed
- after cleaning the apartment
- electrical conducting work is completed

Brickwork Check.

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✕ for minor mistake that requires minor correction.
3. Mark ✕✕ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✕✕✕ for major mistake that cannot be corrected.
5. Wall thickness should be as per plan. Use of 4", 6" & 8" blocks must be checked.
6. All walls should have 2 beds of about 2" to 3" thickness with one no. 6 mm or 8 mm rod with M15 CC.
7. Chicken mesh should be used in each and every joint between RCC & Brickwork.
8. Joint between brickwork & beam on external side must be filled.
9. Check room dimensions with working plan. (Tolerance: 1")
10. Diagonals of each room shall be equal. (Tolerance: 2")
11. Balcony sill level should be 3'3" from SFL. (Tolerance: 1")
12. Check room height with specified height. (Tolerance: 1")
13. Check plumb of walls wherever it appears to be out of plumb. (Tolerance: 1/2")
14. Specify the No. of beams which are not aligned by more than 1" in a room.
15. Door frames must have black Japan coating and wood primer / pellambar – at cost of painter.

Quality Control Check Repot.

Stage: After Brickwork (Apartments/ Lab Spaces)

S No	Room	Wall thickness (✓ or ✗)	Beds in walls (✓ or ✗)	Chicken mesh (✓ or ✗)	External brickwork & beam joint (✓ or ✗)	Room Dimensions (✓ or ✗)	Room Dimensions Difference in inches	Diagonal (✓ or ✗)	Diagonal Difference in inches	Balcony sill level (✓ or ✗)	Room Height (✓ or ✗)	Plumb of walls (Good/Avg./Bad)	Alignment of beams and walls - Nos.
1	Bedroom 1 M-Bed	✓	✓	✓	✓	✓	—	✓	—	—	✓	avg	—
2	Toilet 1 M-Toi	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
3	Bedroom 2 K-Bed	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
4	Toilet 2 C-Toi	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
5	Bedroom 3	—	—	—	—	—	—	—	—	—	—	—	—
6	Toilet 3	—	—	—	—	—	—	—	—	—	—	—	—
7	Drawing	✓	✓	✓	—	✓	—	✓	—	—	✓	avg	—
8	Dining	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
9	Lobby 1	—	—	—	—	—	—	—	—	—	—	—	—
10	Utility / balcony 1	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
11	Utility / balcony 2	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
12	Utility / balcony 3	—	—	—	—	—	—	—	—	—	—	—	—
13	Kitchen	✓	✓	✓	—	✓	—	✓	—	—	✓	avg.	—
14	Other												
15	Other												
Remarks													
1) Fixing of couple of electrical Boxes to be improved													
2) 2" angle's were not provided for door frame's, kitchen chajja was damaged.													
3) Brickwork workmanship to be improved in the flat, laying of chicken mesh and wall Bed's to be improved.													

Quality Control Check Repot. Stage: After Brickwork (Apartments/ Lab Spaces)

Quality of edges and corners in all rooms?	☐ Good ☒ Avg. ☐ Bad
Specify rooms that need correction:	

Misc. Checks.

Was 3.75 CFT proportion box provided?	☐ Yes ☒ No
Condition of proportion box?	☐ Good ☒ Avg. ☐ Bad
Was the Apartment cleaned before starting brick work?	☐ Yes ☐ No ☒ Cant' say
Is the Apartment cleaned for plastering?	☒ Yes ☐ No
Wastage?	☐ High ☒ Medium ☐ Low
Storage of building material like bricks sand and cement.	☐ Good ☒ Avg. ☐ Bad
Drum (200 ltrs) provided for curing in each flat?	☒ Yes ☐ No
Remarks:	

Door Frames & Windows check

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✕ for minor mistake that requires minor correction.
3. Mark ✕✕ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✕✕✕ for major mistake that cannot be corrected.
5. Window template depth should be between 2 to 2 ½" after plastering.
6. Lintel level should be 7'3" from SFL & 7' from FFL. (Tolerance 1"). Lintel should be as per standard design.
7. Lofts should be at a height of 7' to 7'3" from FFL. Kitchen platform thickness should be 2", SFL to bottom 31".. (Tolerance 1")
8. Slopes of lofts and kitchen platforms to be checked by using 12" spirit level and check height from floor from 2 or 3 points.
9. Thickness of platforms & lofts should be between 2 & 2.5".
10. Provide single layer table brick at bottom of each door frame without threshold.
11. Check Z angle template size (Z angle for bathroom ventilators not required in new projects).
12. Window opening must be checked with MS square pipe templates of 2 sizes for inner and outer openings.
13. Z angle template must be 1" from brick wall surface from the inner side.

Quality Control Check Report.

Stage: After Brickwork (Apartments/ Lab Spaces)

S No	Room	Door size, face and position (✓ or ✗)	Brick at bottom of door frame 10 (✓ or ✗)	Door frame hold fast provision and fasteners. (✓ or ✗)	Door lintel design & level (✓ or ✗)	Door diagonal check (✓ or ✗)	Door Plumb - two sides (✓ or ✗)	Windows lintel design & level. Sill level (✓ or ✗)	Windows size (✓ or ✗)	Windows - template depth & diagonal (✓ or ✗)	Windows - template red oxide painting (✓ or ✗)	Loft & Kitchen platform height (✓ or ✗)	Loft & Kitchen platform slope (✓ or ✗)	Door size, face and position (✓ or ✗)
1	Bedroom 1 M-Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
2	Toilet 1 M-Toi	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
3	Bedroom 2 K-Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
4	Toilet 2 C-Toi	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
5	Bedroom 3	-	-	-	-	-	-	-	-	-	-	-	-	-
6	Toilet 3	-	-	-	-	-	-	-	-	-	-	-	-	-
7	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
8	Dining	-	-	-	-	-	-	-	-	-	-	-	-	-
9	Lobby 1	-	-	-	-	-	-	-	-	-	-	-	-	-
10	Utility / balcony 1	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
11	Utility / balcony 2	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
12	Utility / balcony 3	-	-	-	-	-	-	-	-	-	-	-	-	-
13	Kitchen	-	-	-	-	-	-	✓	✓	✓	✓	-	-	-
14	Other													
15	Other													
	Remarks: 1) Boiss work near ventilator to be improved, kitchen platform was not casted, loft hatching was not done.													

Quality Control Check Report. Stage: After Brickwork (Apartments/ Lab Spaces)

Flat No.	A-116	Others		Sl. No.	41746
Company	M R G V	Project	B R G V	Phase	-
Prepared by	P-Bharath	Sign	P-B	Date	29-04-23
Project Manager	Sowmya Abishek	Sign	Abhishek	Date	29-04-23
Previous Stage report no.	41000	Report filed and signed by PM?		☒ Yes ☐ No	
Apartment No.		Other		other	
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No
Recommendation: ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC. ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team. ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required. ☐ Proceed with further work. ATR not required.					

Inspection should be done after:

- brickwork is completed
- chicken mesh fixed
- after cleaning the apartment
- electrical conducting work is completed

Brickwork Check.

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. Wall thickness should be as per plan. Use of 4", 6" & 8" blocks must be checked.
6. All walls should have 2 beds of about 2" to 3" thickness with one no. 6 mm or 8 mm rod with M15 CC.
7. Chicken mesh should be used in each and every joint between RCC & Brickwork.
8. Joint between brickwork & beam on external side must be filled.
9. Check room dimensions with working plan. (Tolerance: 1")
10. Diagonals of each room shall be equal. (Tolerance: 2")
11. Balcony sill level should be 3'3" from SFL. (Tolerance: 1")
12. Check room height with specified height. (Tolerance: 1")
13. Check plumb of walls wherever it appears to be out of plumb. (Tolerance: 1/2")
14. Specify the No. of beams which are not aligned by more than 1" in a room.
15. Door frames must have black Japan coating and wood primer / pellambar – at cost of painter.

Quality Control Check Repot.

Stage: After Brickwork (Apartments/ Lab Spaces)

S No	Room	Wall thickness (✓ or ✗)	Beds in walls (✓ or ✗)	Chicken mesh (✓ or ✗)	External brickwork & beam joint (✓ or ✗)	Room Dimensions (✓ or ✗)	Room Dimensions Difference in inches	Diagonal (✓ or ✗)	Diagonal Difference in inches	Balcony sill level (✓ or ✗)	Room Height (✓ or ✗)	Plumb of walls (Good/Avg./Bad)	Alignment of beams and walls - Nos.
1	Bedroom 1 M-Bed	✓	✓	✓	✓	✓	—	✓	—	—	✓	avg	—
2	Toilet 1 M-Toi	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
3	Bedroom 2 K-Bed	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
4	Toilet 2 C-Toi	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
5	Bedroom 3	—	—	—	—	—	—	—	—	—	—	—	—
6	Toilet 3	—	—	—	—	—	—	—	—	—	—	—	—
7	Drawing	✓	✓	✓	—	✓	—	✓	—	—	✓	avg	—
8	Dining	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
9	Lobby 1	—	—	—	—	—	—	—	—	—	—	—	—
10	Utility / balcony 1	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
11	Utility / balcony 2	✓	✓	✓	—	✓	—	✓	—	—	✓	"	—
12	Utility / balcony 3	—	—	—	—	—	—	—	—	—	—	—	—
13	Kitchen	✓	✓	✓	—	✓	—	✓	—	—	✓	avg.	—
14	Other												
15	Other												
Remarks													
1) Fixing of couple of electrical Boxes to be improved													
2) 2" angle's were not provided for door frame's, kitchen chajja was damaged.													
3) Brickwork workmanship to be improved in the flat, laying of chicken mesh and wall Bed's to be improved.													

Quality Control Check Repot. Stage: After Brickwork (Apartments/ Lab Spaces)

Quality of edges and corners in all rooms?	☐ Good ☒ Avg. ☐ Bad
Specify rooms that need correction:	

Misc. Checks.

Was 3.75 CFT proportion box provided?	☐ Yes ☒ No
Condition of proportion box?	☐ Good ☒ Avg. ☐ Bad
Was the Apartment cleaned before starting brick work?	☐ Yes ☐ No ☒ Cant' say
Is the Apartment cleaned for plastering?	☒ Yes ☐ No
Wastage?	☐ High ☒ Medium ☐ Low
Storage of building material like bricks sand and cement.	☐ Good ☒ Avg. ☐ Bad
Drum (200 ltrs) provided for curing in each flat?	☒ Yes ☐ No
Remarks:	

Door Frames & Windows check

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✕ for minor mistake that requires minor correction.
3. Mark ✕✕ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✕✕✕ for major mistake that cannot be corrected.
5. Window template depth should be between 2 to 2 ½" after plastering.
6. Lintel level should be 7'3" from SFL & 7' from FFL. (Tolerance 1"). Lintel should be as per standard design.
7. Lofts should be at a height of 7' to 7'3" from FFL. Kitchen platform thickness should be 2", SFL to bottom 31".. (Tolerance 1")
8. Slopes of lofts and kitchen platforms to be checked by using 12" spirit level and check height from floor from 2 or 3 points.
9. Thickness of platforms & lofts should be between 2 & 2.5".
10. Provide single layer table brick at bottom of each door frame without threshold.
11. Check Z angle template size (Z angle for bathroom ventilators not required in new projects).
12. Window opening must be checked with MS square pipe templates of 2 sizes for inner and outer openings.
13. Z angle template must be 1" from brick wall surface from the inner side.

Quality Control Check Report.

Stage: After Brickwork (Apartments/ Lab Spaces)

S No	Room	Door size, face and position (✓ or ✗)	Brick at bottom of door frame 10 (✓ or ✗)	Door frame hold fast provision and fasteners. (✓ or ✗)	Door lintel design & level (✓ or ✗)	Door diagonal check (✓ or ✗)	Door Plumb - two sides (✓ or ✗)	Windows lintel design & level. Sill level (✓ or ✗)	Windows size (✓ or ✗)	Windows - template depth & diagonal (✓ or ✗)	Windows - template red oxide painting (✓ or ✗)	Loft & Kitchen platform height (✓ or ✗)	Loft & Kitchen platform slope (✓ or ✗)	Door size, face and position (✓ or ✗)
1	Bedroom 1 - M-Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
2	Toilet 1 M-Toi	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
3	Bedroom 2 - K-Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
4	Toilet 2 C-Toi	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
5	Bedroom 3	-	-	-	-	-	-	-	-	-	-	-	-	-
6	Toilet 3	-	-	-	-	-	-	-	-	-	-	-	-	-
7	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
8	Dining	-	-	-	-	-	-	-	-	-	-	-	-	-
9	Lobby 1	-	-	-	-	-	-	-	-	-	-	-	-	-
10	Utility / balcony 1	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
11	Utility / balcony 2	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
12	Utility / balcony 3	-	-	-	-	-	-	-	-	-	-	-	-	-
13	Kitchen	-	-	-	-	-	-	✓	✓	✓	✓	-	-	-
14	Other													
15	Other													
	Remarks: 1) Boiss work near ventilator to be improved, Kitchen platform was not casted, loft hatching was not done.													

Quality Control Check Report. Stage: After Plastering (Apartments)

Flat No.	A-116	Other	—	Sl. No.	42096
Company	MRGV	Project	BRGV	Phase	—
Prepared by	SAMIRAN	Sign	<i>[Signature]</i>	Date	24-07-2023
Project Manager	SARNAR	Sign	<i>[Signature]</i>	Date	24-07-2023
Previous stage report no.	41746	Report filed and signed by PM?	☒ Yes ☐ No		
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No
Recommendation: ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC. ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team. ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required. ☐ Proceed with further work. ATR not required.					

Inspection should be done after:

- brickwork & 2 coats plastering is completed
- after cleaning the villa.
- Water proofing, screeding in bathrooms is completed.
- before starting painting, tiling & flooring.

Plastering Check

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. 9" unplastered area from SFL should be left including in common areas and terraces.
6. Windows must be checked with templates. Plastering must be 3mm margin for luppum work. Tolerance ¼".
7. Provision of tiles in bathrooms, kitchen & wash areas (rough plastering).
8. Check size of sink bowl. Hole should be 1" to 2" larger. (Tolerance: 1")
9. All doors frames should have ½" grooves.
10. Sill top must be of uniform thickness, correct height, at one level & without broken edges.

Quality Control Check Report. Stage: After Plastering (Apartments)

S No	Room	Skirting Provision (✓ or ✗)	Furnishing around door frame (✓ or ✗)	Beams & columns finishing (✓ or ✗)	Finishing of lofts (✓ or ✗)	Electricity junctions finishing (✓ or ✗)	Windows check (✓ or ✗)	Tiles provision (✓ or ✗)	Sink provision & size (✓ or ✗)	Grooves for door frames (✓ or ✗)	Balcony & terrace sill top finishing (✓ or ✗)	Screeding in bathroom & utility (✓ or ✗)	Screeding in 6" above FFL? (✓ or ✗)
1	Bedroom 1 M-Bed	✓	✗	✓	✓	✓	✗	✓	✓	✓	✓	✓	✓
2	Toilet 1 M-Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
3	Bedroom 2 G-Bed	✓	✓	✓	✓	✓	✓	✓	✓	✗	✓	✓	✓
4	Toilet 2 C-Toi	✓	✗	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
5	Bedroom 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Toilet 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Bedroom 4	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Toilet 4	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
9	Drawing	✓	✓	✓	✓	✓	✗	✓	✓	✓	✓	✓	✓
10	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
11	Lobby 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
12	Lobby 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
13	Balcony	✓	✓	✓	✓	✓	✓	✓	✓	✗	✓	✓	✓
14	Utility	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
15	Portico	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
16	Kitchen	✓	✓	✓	✓	✓	✗	✓	✓	✓	✓	✓	✓
17	Other												
Remarks													

Quality Control Check Report. Stage: After Plumbing & Electrical (Apartments)

Flat No.	A-116	Other	-	Sl. No.	42436
Company	MRGV	Project	BRGV	Phase	-
Prepared by	P. Bharath	Sign	<i>[Signature]</i>	Date	03-10-23
Project Manager	Saxena	Sign	<i>[Signature]</i>	Date	03-10-23
Previous stage report no.	41746	Report filed and signed by PM?		☒ Yes ☐ No	
Additions & alterations sheet date	21/06/23	All pages signed by engineer & customer?		☒ Yes ☐ No	
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No
Recommendation: ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC. ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team. ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required. ☐ Proceed with further work. ATR not required.					

Inspection should be done after:

- after cleaning the apartment.
- before starting painting, tiling & flooring.
- electrical conduct, waterproofing & plumbing work is completed (for stage II only).
- additions & alterations is finalized and signed. In case there are no additions and alterations printout of email by PM to CR confirming the same must be filed.
- additions & alterations sheets to be transferred to QC file. QC to check if A&A are made as per request.

After Plumbing & Electrical Check.

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. Location of CPVC & PVC fittings must be checked as per measurements given in circular. Tolerance 1".
6. Location, height and spirit level of electrical points must be checked as per measurements given in circular & plan. Tolerance 1".
7. Civil work near pipes in balcony & utility must be neat and mortar should be removed from the pipes.
8. Water proofing must cover all pipes & check height above SFL.
9. Fasteners must be used as specified in circular. Especially check fixing of PVC pipes.
10. Height of DB box must be 6" below false ceiling level or 12" below slab level.
11. In case of many changes in civil work, electrical work and plumbing work, a new drawing must be prepared at HO and approved by MD.

Quality Control Check Report. Stage: After Plumbing & Electrical (Apartments)

S No	Room	Civil work near pipes in balcony & utility ⁷ (✓ or ✕)	CPVC & PVC Check ⁵ (✓ or ✕)	Electrical points check ⁶ (✓ or ✕)	Water proofing check ⁸ (✓ or ✕)	Proper use of fasteners check ⁹ (✓ or ✕)	Placement of DB ¹⁰ (✓ or ✕)	Placement of Generator changeover (✓ or ✕)
1	Bedroom 1 <i>M-Bed</i>	—	—	✓	—	—	—	—
2	Toilet 1 <i>M-Toi</i>	—	✓	✓	✓	✓	—	—
3	Bedroom 2 <i>K-Bed</i>	—	—	✓	—	—	—	—
4	Toilet 2 <i>C-Toi</i>	—	✓	✓	✓	✓	—	—
5	Bedroom 3	—	—	—	—	—	—	—
6	Toilet 3	—	—	—	—	—	—	—
7	Drawing	—	—	✓	—	—	✓	—
8	Dining	—	—	✓	—	—	—	—
9	Lobby 1	—	—	—	—	—	—	—
10	Utility / balcony 1	✓	✓	✓	✓	✓	—	—
11	Utility / balcony 2	—	✓	✓	—	✓	—	—
12	Utility / balcony 3	—	—	—	—	—	—	—
13	Kitchen	—	✓	✓	—	—	—	—
14	Other							
15	Other							
Remarks								
Remarks on additions & alteration sheet:								
Signed by engineer,		☒ Yes ☐ No		Signed by customer,		☐ Yes ☒ No		
Revised drawing required from HO		☐ Yes ☒ No		Approved revised drawing attached		☐ Yes ☒ No		

Quality Control Check Repot. Stage: After Plumbing & Electrical (Apartments)

Miscellaneous check

Screeding done on walls upto 12" outside bathroom/utility	☒ Yes ☐ No
Bathroom /utility filled with 4" water for water proof check	☒ Yes ☐ No
Hole packing done around all pipes in ceiling and internal walls	☒ Yes ☐ No
Remarks:	

Quality Control Check Report. Stage: After Brickwork (Apartments/ Lab Spaces)

Flat No.	A-116	Others		Sl. No.	41746
Company	MRGV	Project	BRGV	Phase	
Prepared by	P-Bharath	Sign	P-B	Date	29-04-23
Project Manager	Sowmya Abishek	Sign	Abishek	Date	29-04-23
Previous Stage report no.	41000	Report filed and signed by PM?		☒ Yes ☐ No	
Apartment No.		Other		other	
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
- ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
- ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
- ☐ Proceed with further work. ATR not required.

Inspection should be done after:

- brickwork is completed
- chicken mesh fixed
- after cleaning the apartment
- electrical conducting work is completed

Brickwork Check.

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. Wall thickness should be as per plan. Use of 4", 6" & 8" blocks must be checked.
6. All walls should have 2 beds of about 2" to 3" thickness with one no. 6 mm or 8 mm rod with M15 CC.
7. Chicken mesh should be used in each and every joint between RCC & Brickwork.
8. Joint between brickwork & beam on external side must be filled.
9. Check room dimensions with working plan. (Tolerance: 1")
10. Diagonals of each room shall be equal. (Tolerance: 2")
11. Balcony sill level should be 3'3" from SFL. (Tolerance: 1")
12. Check room height with specified height. (Tolerance: 1")
13. Check plumb of walls wherever it appears to be out of plumb. (Tolerance: 1/2")
14. Specify the No. of beams which are not aligned by more than 1" in a room.
15. Door frames must have black Japan coating and wood primer / pellambar – at cost of painter.

Quality Control Check Repot.

Stage: After Brickwork (Apartments/ Lab Spaces)

S No	Room	Wall thickness (✓ or ✗)	Beds in walls (✓ or ✗)	Chicken mesh (✓ or ✗)	External brickwork & beam joint (✓ or ✗)	Room Dimensions (✓ or ✗)	Room Dimensions Difference in inches	Diagonal (✓ or ✗)	Diagonal Difference in inches	Balcony sill level (✓ or ✗)	Room Height (✓ or ✗)	Plumb of walls (Good/Avg./Bad)	Alignment of beams and walls - Nos.
1	Bedroom 1 M-Bed	✓	✓	✓	-	✓	-	✓	-	-	✓	avg	-
2	Toilet 1 M-Toi	✓	✓	✓	-	✓	-	✓	-	-	✓	"	-
3	Bedroom 2 K-Bed	✓	✓	✓	-	✓	-	✓	-	-	✓	"	-
4	Toilet 2 C-Toi	✓	✓	✓	-	✓	-	✓	-	-	✓	"	-
5	Bedroom 3	-	-	-	-	-	-	-	-	-	-	-	-
6	Toilet 3	-	-	-	-	-	-	-	-	-	-	-	-
7	Drawing	✓	✓	✓	-	✓	-	✓	-	-	✓	avg	-
8	Dining	✓	✓	✓	-	✓	-	✓	-	-	✓	"	-
9	Lobby 1	-	-	-	-	-	-	-	-	-	-	-	-
10	Utility / balcony 1	✓	✓	✓	-	✓	-	✓	-	-	✓	"	-
11	Utility / balcony 2	✓	✓	✓	-	✓	-	✓	-	-	✓	"	-
12	Utility / balcony 3	-	-	-	-	-	-	-	-	-	-	-	-
13	Kitchen	✓	✓	✓	-	✓	-	✓	-	-	✓	avg.	-
14	Other												
15	Other												
Remarks													
1) Fixing of couple of electrical Boxes to be improved													
2) 2" angle's were not provided for door frame's, kitchen chajja was damaged.													
3) Brickwork workmanship to be improved in the flat, laying of chicken mesh and wall Bed's to be improved.													

Quality Control Check Repot. Stage: After Brickwork (Apartments/ Lab Spaces)

Quality of edges and corners in all rooms?	☐ Good ☒ Avg. ☐ Bad
Specify rooms that need correction:	

Misc. Checks.

Was 3.75 CFT proportion box provided?	☐ Yes ☒ No
Condition of proportion box?	☐ Good ☒ Avg. ☐ Bad
Was the Apartment cleaned before starting brick work?	☐ Yes ☐ No ☒ Cant' say
Is the Apartment cleaned for plastering?	☒ Yes ☐ No
Wastage?	☐ High ☒ Medium ☐ Low
Storage of building material like bricks sand and cement.	☐ Good ☒ Avg. ☐ Bad
Drum (200 ltrs) provided for curing in each flat?	☒ Yes ☐ No
Remarks:	

Door Frames & Windows check

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✕ for minor mistake that requires minor correction.
3. Mark ✕✕ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✕✕✕ for major mistake that cannot be corrected.
5. Window template depth should be between 2 to 2 ½" after plastering.
6. Lintel level should be 7'3" from SFL & 7' from FFL. (Tolerance 1"). Lintel should be as per standard design.
7. Lofts should be at a height of 7' to 7'3" from FFL. Kitchen platform thickness should be 2", SFL to bottom 31".. (Tolerance 1")
8. Slopes of lofts and kitchen platforms to be checked by using 12" spirit level and check height from floor from 2 or 3 points.
9. Thickness of platforms & lofts should be between 2 & 2.5".
10. Provide single layer table brick at bottom of each door frame without threshold.
11. Check Z angle template size (Z angle for bathroom ventilators not required in new projects).
12. Window opening must be checked with MS square pipe templates of 2 sizes for inner and outer openings.
13. Z angle template must be 1" from brick wall surface from the inner side.

Quality Control Check Report.

Stage: After Brickwork (Apartments/ Lab Spaces)

S No	Room	Door size, face and position (✓ or ✗)	Brick at bottom of door frame 10 (✓ or ✗)	Door frame hold fast provision and fasteners. (✓ or ✗)	Door lintel design & level (✓ or ✗)	Door diagonal check (✓ or ✗)	Door Plumb - two sides (✓ or ✗)	Windows lintel design & level. Sill level (✓ or ✗)	Windows size (✓ or ✗)	Windows - template depth & diagonal (✓ or ✗)	Windows - template red oxide painting (✓ or ✗)	Loft & Kitchen platform height (✓ or ✗)	Loft & Kitchen platform slope (✓ or ✗)	Door size, face and position (✓ or ✗)
1	Bedroom 1 M-Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
2	Toilet 1 M-Toi	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
3	Bedroom 2 K-Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
4	Toilet 2 C-Toi	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
5	Bedroom 3	-	-	-	-	-	-	-	-	-	-	-	-	-
6	Toilet 3	-	-	-	-	-	-	-	-	-	-	-	-	-
7	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	-	-
8	Dining	-	-	-	-	-	-	-	-	-	-	-	-	-
9	Lobby 1	-	-	-	-	-	-	-	-	-	-	-	-	-
10	Utility / balcony 1	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
11	Utility / balcony 2	✓	✓	✓	✓	✓	✓	-	-	-	-	-	-	-
12	Utility / balcony 3	-	-	-	-	-	-	-	-	-	-	-	-	-
13	Kitchen	-	-	-	-	-	-	✓	✓	✓	✓	-	-	-
14	Other													
15	Other													
	Remarks: 1) Boiss work near ventilator to be improved, Kitchen platform was not casted, loft hauring was not done.													

Quality Control Check Report. Stage: After Plastering (Apartments)

Flat No.	A-116	Other	—	Sl. No.	42096
Company	MRGV	Project	BRGV	Phase	—
Prepared by	SAMIRAN	Sign	<i>[Signature]</i>	Date	24-07-2023
Project Manager	SARNAR	Sign	<i>[Signature]</i>	Date	24-07-2023
Previous stage report no.	41746	Report filed and signed by PM?	☒ Yes ☐ No		
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No
Recommendation: ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC. ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team. ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required. ☐ Proceed with further work. ATR not required.					

Inspection should be done after:

- brickwork & 2 coats plastering is completed
- after cleaning the villa.
- Water proofing, screeding in bathrooms is completed.
- before starting painting, tiling & flooring.

Plastering Check

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. 9" unplastered area from SFL should be left including in common areas and terraces.
6. Windows must be checked with templates. Plastering must be 3mm margin for luppum work. Tolerance ¼".
7. Provision of tiles in bathrooms, kitchen & wash areas (rough plastering).
8. Check size of sink bowl. Hole should be 1" to 2" larger. (Tolerance: 1")
9. All doors frames should have ½" grooves.
10. Sill top must be of uniform thickness, correct height, at one level & without broken edges.

Quality Control Check Report. Stage: After Plastering (Apartments)

S No	Room	Skirting Provision (✓ or ✗)	Furnishing around door frame (✓ or ✗)	Beams & columns finishing (✓ or ✗)	Finishing of lofts (✓ or ✗)	Electricity junctions finishing (✓ or ✗)	Windows check (✓ or ✗)	Tiles provision (✓ or ✗)	Sink provision & size (✓ or ✗)	Grooves for door frames (✓ or ✗)	Balcony & terrace sill top finishing (✓ or ✗)	Screeding in bathroom & utility (✓ or ✗)	Screeding in 6" above FFL? (✓ or ✗)
1	Bedroom 1 M-Bed	✓	✗	✓	✓	✓	✗	✓	✓	✓	✓	✓	✓
2	Toilet 1 M-Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
3	Bedroom 2 G-Bed	✓	✓	✓	✓	✓	✓	✓	✓	✗	✓	✓	✓
4	Toilet 2 C-Toi	✓	✗	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
5	Bedroom 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Toilet 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Bedroom 4	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Toilet 4	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
9	Drawing	✓	✓	✓	✓	✓	✗	✓	✓	✓	✓	✓	✓
10	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
11	Lobby 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
12	Lobby 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
13	Balcony	✓	✓	✓	✓	✓	✓	✓	✓	✗	✓	✓	✓
14	Utility	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
15	Portico	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
16	Kitchen	✓	✓	✓	✓	✓	✗	✓	✓	✓	✓	✓	✓
17	Other												
Remarks													

Check report by Sales + CR after finishing stage IV (Apartments)

Flat No	116	Other		SL. No.	43167
Company	mRAY LLP	Project	BRAY	Phase	
Prepared by	Venkat Reddy	Sign		Date	
Project Manager	Sarwar	Sign		Date	
Stage II report no.					
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No
Recommendation: ☒ Work is satisfactorily completed. Possession may be handed over. ☐ Minor corrections given herein to be completed before handing over possession. ☐ Major corrections required. Do not handover possession. Request for recheck after completion of works. ☐ Works incomplete. Check report cannot be prepared. Request for recheck after completion of works.					

Notes:

- Site to make request for stage IV inspection on M-codex. QC to forward request by email to Sales/CR manager with SI No. generated by M-codex.
- Inspection to be carried out with one member of sales team and CR team + site engineer within 3 days of request.
- Site engineer shall ensure that all works are completed and the flat is thoroughly cleaned in all respects before requesting for inspection.
- Possession cannot be handed over to customer without this inspection.
- Report to be made on same day. Scanned copy to be sent to CR for uploading. Original to be sent to Ashaiya.
- Mark green tick if work is completed. Red 'x' if minor corrections are required. Red 'xx' if work not completed/needs major corrections. Mark 'NA' if not applicable.


07/10/24

Check report by Sales + CR after finishing stage IV (Apartments)

Miscellaneous check (check for quality & completion):

Modular kitchen	N/A	Security camera provided	N/A - NO
Main door soffit quality	✓	False ceiling provided by developer	N/A
No material is stored in flat	✓	Properly labelled keys – 3 sets	✓
Loft tank installed in utility	✓	Kitchen granite platform and dado	✓
Loft provided	✓	Loft finishing	✓
Water supply	✓	Electricity supply	✓
Generator backup (auto)	✓	Car parking provided	✓
Flat label	✓	Car parking label	✓
Provision of lift	✓	Cleanliness of corridors + staircase	✓
Remarks:			

Check report by Sales + CR after finishing stage IV (Apartments)

S No	Room/ quality check	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15
		Bedroom 1	Bedroom 2	Bedroom 3	Drawing	Dining	Lobby 1	Utility / balcony 1	Utility / balcony 2	Utility / balcony 3	Kitchen	Toilet 1	Toilet 2	Toilet 3	Other:	Other:
	Floor & wall tiles	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Painting	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Doors + hardware + door beading	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Windows/ventilator + grill + hardware	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Electricals – switches, switch boards, points	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	CP & sanitary fittings							✓			✓	✓	✓			
	Ratings															
	Painting of exposed pipes + hole packing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Air cracks are treated and painted	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Seepages (Nil)	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Cleanliness /removal of paint spots	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		

Quality Control Check Repot. Stage: After Finishing Stage II (Apartments)

Flat No	116	Other	—	Sl. No.	42710
Company	MRAV	Project	BRUV	Phase	—
Prepared by	Sailesh	Sign	<i>[Signature]</i>	Date	02/01/2024
Project Manager	Sarkar	Sign	<i>[Signature]</i>	Date	02/01/2024
Previous stage report no.			Report filed and signed by PM	☐ Yes ☒ No	
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
- ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
- ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
- ☐ Proceed with further work. ATR not required.

Inspection should be done after:

- Completion of flooring, bathroom /utility tiles, first coat of paint.
- Completion of doors, windows, grills, electrical wiring, switches must be done in next stage
- False ceiling must be completed before flooring.
- Kitchen platform, granite and dado must be completed where modular kitchen is not provided.
- Provide granite soffit for main door and balconies in this stage.

Miscellaneous check:

Main door fixed with lock & stopper	☒ Yes ☐ No		
Granite soffit for balcony required	☐ Yes ☒ No	Granite soffit for balcony provided	☐ Yes ☐ No —
Balcony granite soffit workmanship	☐ Good ☐ Avg ☐ Poor	Balcony granite soffit edge polishing	☐ Good ☐ Avg ☐ Poor
Granite soffit for main door required	☐ Yes ☒ No	Granite soffit for main door provided	☐ Yes ☐ No —
Main door granite soffit workmanship	☐ Good ☐ Avg ☐ Poor	Main door granite soffit edge polishing	☐ Good ☐ Avg ☐ Poor

Quality Control Check Repot. Stage: After Finishing Stage II (Apartments)

Tiling & granite work		Rate the quality of (Good ✓, Avg. ✕, Poor – needs correction ✕✕, NA)												
S No	Room	Workmanship of tiling	White cement filling around CPVC lines	Corners finishing	Finishing near doors	Finishing on top of tiles	Finishing near ventilators	Step at bathroom entrance / utility	Step for shower / pot wash	Tile joint grouting	Granite platform finishing and edge polishing	Granite platform slope	Granite platform height	Finishing under granite platform
1	Toilet 1 M-toi	✓	✕	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
2	Toilet 2 C-toi	✓	✕	✓	✕	✓	✓	✓	✓	✓	✓	✓	✓	✓
3	Toilet 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
4	Toilet 4	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
5	Wash basin in dining area	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Kitchen	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Utility	✓	✕	✓	✕	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Other													
9	Other													
Remarks														

Quality Control Check Repot. Stage: After Finishing Stage II (Apartments)

Flooring & painting		Rate the quality of (Good ✓, Avg. ✕, Poor – needs correction ✕✕, NA)												
S No	Room	Color variation of floor tiles	Flooring workmanship & grouting	Skirting size (3")	Skirting workmanship	Plastering above skirting	Plastering & finishing of walls	Crack filling	Loft Finishing	Windows check	General quality of painting & finishing	Door & frame painting quality	Door beading, luppam and painting quality.	Edge building
1	Bedroom 1 <i>M.Red</i>	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✕
2	Bedroom 2 <i>G.Red</i>	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
3	Bedroom 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
4	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✕
5	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Lobby 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Utility / balcony 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Utility / balcony 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✕
9	Utility / balcony 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
10	Kitchen	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✕
11	Other													
12	Other													
Remarks		NOTE :- (1) General painting & door painting work to be improve.												
		(2) Flat to be clean.												

Construction division.

Notes: 1. ~~For~~ **For** measurement & estimate sheet. 2. Send scanned copy by email to plans@modiproperties.com & CR. 3. Maintain originals in A&A file of customers at site.

27 SEP 2024
SYED GOLAM SARWAR
ASSY PROJECT LTD.
ASS BRGY. PMT.

ESTIMATE SHEET

Company Name:

MRGV

Project:

BRGV

Work Description:

Extra Specs

F no :-

Srinivas - 116

Prepared By

Sarwar

Date:

27-09-2024

S No.

Item Head

Refund charges

Extra charges

1

Flooring (4x2 tiles

Specialty Tile

2

3

4

5

Approved by:

Sign:

Item Description

Quantity

Units

Rate

Amount

Item Head Total

Total Amount :-A

438.00 SFT

35.00

15,330

Grand Total Extra charges(B-A)

Total Amount :-B

15,330

15,330

Amount in words:- Eighteen Thousand Three Hundred Thirty Three Rupees only

BLOOMDALE

Residency @ Genome Valley

Shamirpet, Hyderabad.

Site Office : Sy. No. 31 & 32, Murali Agrivally,
Medchal Mandal, Hyderabad - 500 078.

Ph: 91-91210 21717

Developed by : M.S. Bloomdale Residency Genome Valley LLP.



Head Office: 5-4-187 3&4, ILEAWE, M.G. Road,
Secunderabad - 500 083. ☎ 91 40663 35551.
✉ info@modiproperties.com www.modiproperties.com

Details of Additions & Alterations

Flat No	116	Type	Deluxe / Semi-Deluxe
Buyer Name	K. Srinivas Rddy		
Phone No.	9533079792	Email	Srinivas.Reddy@gmail.com

I hereby confirm that I have given the details of the minor additions and alterations that are required in the above referred flat in the pages attached herein. Please complete the changes suggested by me. I agree to pay the charges, if any, for the additions and alterations that I have asked you to make, as per the rates suggested by you. I shall deliver all the materials that are required to be provided by me at the site on or before _____.

In case I fail to deliver these items to the site by the specified date, you may complete the works in the flat as per the standard items provided by you.

Buyers sign		Engg. Sign	TJA
Date:		Date	21/06/2023

Note:

1. Colour shades of paints may vary from batch to batch & company to company. The Builder will not take responsibility of quality of work for dark shades especially green & blue.
2. Shade / colour of natural material like marble and granite can't be guaranteed and may vary from lot to lot. Cracks like appearance in marble is a natural feature and Builder shall not be responsible for repairs or replacement.
3. Availability of bathroom or flooring tiles of the same type /colour/make can not be guaranteed and closest possible type/colour/make may be used in its place.
4. No further change shall be permitted from this day.
5. Please sign on all pages.

Choice of colours:

Changes in flooring:

① M.B. classic wenge tiles

② C.B. Walnut tiles

③ In Hall → similar to grey ceria (Craigio Stone)

✗ for Hall + passage + kitchen = willington grey

Changes in electrical points: (mark on plan)

Choice of Bathroom tiles, CP fittings & Sanitary ware:

Master bedroom And children bedroom
* for master bedroom - classic wenge ✓
A children bedroom = autumn walnut.

∴ Bath toilet = duna.

Changes in kitchen platform: (mark on plan)

□ kitch tiles → should be on hold.

kitchen dado - Country choklet

12

Details of solar water heater:

Other Changes:



100

1990

1. 2. 3. 4. 5. 6. 7. 8. 9. 10. 11. 12. 13. 14. 15. 16. 17. 18. 19. 20. 21. 22. 23. 24. 25. 26. 27. 28. 29. 30. 31. 32. 33. 34. 35. 36. 37. 38. 39. 40. 41. 42. 43. 44. 45. 46. 47. 48. 49. 50. 51. 52. 53. 54. 55. 56. 57. 58. 59. 60. 61. 62. 63. 64. 65. 66. 67. 68. 69. 70. 71. 72. 73. 74. 75. 76. 77. 78. 79. 80. 81. 82. 83. 84. 85. 86. 87. 88. 89. 90. 91. 92. 93. 94. 95. 96. 97. 98. 99. 100. 101. 102. 103. 104. 105. 106. 107. 108. 109. 110. 111. 112. 113. 114. 115. 116. 117. 118. 119. 120. 121. 122. 123. 124. 125. 126. 127. 128. 129. 130. 131. 132. 133. 134. 135. 136. 137. 138. 139. 140. 141. 142. 143. 144. 145. 146. 147. 148. 149. 150. 151. 152. 153. 154. 155. 156. 157. 158. 159. 160. 161. 162. 163. 164. 165. 166. 167. 168. 169. 170. 171. 172. 173. 174. 175. 176. 177. 178. 179. 180. 181. 182. 183. 184. 185. 186. 187. 188. 189. 190. 191. 192. 193. 194. 195. 196. 197. 198. 199. 200. 201. 202. 203. 204. 205. 206. 207. 208. 209. 210. 211. 212. 213. 214. 215. 216. 217. 218. 219. 220. 221. 222. 223. 224. 225. 226. 227. 228. 229. 230. 231. 232. 233. 234. 235. 236. 237. 238. 239. 240. 241. 242. 243. 244. 245. 246. 247. 248. 249. 250. 251. 252. 253. 254. 255. 256. 257. 258. 259. 260. 261. 262. 263. 264. 265. 266. 267. 268. 269. 270. 271. 272. 273. 274. 275. 276. 277. 278. 279. 280. 281. 282. 283. 284. 285. 286. 287. 288. 289. 290. 291. 292. 293. 294. 295. 296. 297. 298. 299. 300. 301. 302. 303. 304. 305. 306. 307. 308. 309. 310. 311. 312. 313. 314. 315. 316. 317. 318. 319. 320. 321. 322. 323. 324. 325. 326. 327. 328. 329. 330. 331. 332. 333. 334. 335. 336. 337. 338. 339. 340. 341. 342. 343. 344. 345. 346. 347. 348. 349. 350. 351. 352. 353. 354. 355. 356. 357. 358. 359. 360. 361. 362. 363. 364. 365. 366. 367. 368. 369. 370. 371. 372. 373. 374. 375. 376. 377. 378. 379. 380. 381. 382. 383. 384. 385. 386. 387. 388. 389. 390. 391. 392. 393. 394. 395. 396. 397. 398. 399. 400. 401. 402. 403. 404. 405. 406. 407. 408. 409. 410. 411. 412. 413. 414. 415. 416. 417. 418. 419. 420. 421. 422. 423. 424. 425. 426. 427. 428. 429. 430. 431. 432. 433. 434. 435. 436. 437. 438. 439. 440. 441. 442. 443. 444. 445. 446. 447. 448. 449. 450. 451. 452. 453. 454. 455. 456. 457. 458. 459. 460. 461. 462. 463. 464. 465. 466. 467. 468. 469. 470. 471. 472. 473. 474. 475. 476. 477. 478. 479. 480. 481. 482. 483. 484. 485. 486. 487. 488. 489. 490. 491. 492. 493. 494. 495. 496. 497. 498. 499. 500. 501. 502. 503. 504. 505. 506. 507. 508. 509. 510. 511. 512. 513. 514. 515. 516. 517. 518. 519. 520. 521. 522. 523. 524. 525. 526. 527. 528. 529. 530. 531. 532. 533. 534. 535. 536. 537. 538. 539. 540. 541. 542. 543. 544. 545. 546. 547. 548. 549. 550. 551. 552. 553. 554. 555. 556. 557. 558. 559. 560. 561. 562. 563. 564. 565. 566. 567. 568. 569. 570. 571. 572. 573. 574. 575. 576. 577. 578. 579. 580. 581. 582. 583. 584. 585. 586. 587. 588. 589. 590. 591. 592. 593. 594. 595. 596. 597. 598. 599. 600. 601. 602. 603. 604. 605. 606. 607. 608. 609. 610. 611. 612. 613. 614. 615. 616. 617. 618. 619. 620. 621. 622. 623. 624. 625. 626. 627. 628. 629. 630. 631. 632. 633. 634. 635. 636. 637. 638. 639. 640. 641. 642. 643. 644. 645. 646. 647. 648. 649. 650. 651. 652. 653. 654. 655. 656. 657. 658. 659. 660. 661. 662. 663. 664. 665. 666. 667. 668. 669. 670. 671. 672. 673. 674. 675. 676. 677. 678. 679. 680. 681. 682. 683. 684. 685. 686. 687. 688. 689. 690. 691. 692. 693. 694. 695. 696. 697. 698. 699. 700. 701. 702. 703. 704. 705. 706. 707. 708. 709. 710. 711. 712. 713. 714. 715. 716. 717. 718. 719. 720. 721. 722. 723. 724. 725. 726. 727. 728. 729. 730. 731. 732. 733. 734. 735. 736. 737. 738. 739. 740. 741. 742. 743. 744. 745. 746. 747. 748. 749. 750. 751. 752. 753. 754. 755. 756. 757. 758. 759. 760. 761. 762. 763. 764. 765. 766. 767. 768. 769. 770. 771. 772. 773. 774. 775. 776. 777. 778. 779. 780. 781. 782. 783. 784. 785. 786. 787. 788. 789. 790. 791. 792. 793. 794. 795. 796. 797. 798. 799. 800. 801. 802. 803. 804. 805. 806. 807. 808. 809. 810. 811. 812. 813. 814. 815. 816. 817. 818. 819. 820. 821. 822. 823. 824. 825. 826. 827. 828. 829. 830. 831. 832. 833. 834. 835. 836. 837. 838. 839. 840. 84

we encourage you to make any minor adjustments or alterations to the plan that you have booked, we will be happy to do so. We encourage you to visit the site during office hours between 10:00-2:27 & 25-06-2023. We also encourage you to include details like color of walls, etc., during your visit to the site. Our site engineers will make note of these details.

1920-1921

11-11-11

1820

[illegible]

Notes:

1. Working drawings, electrical layout & plumbing drawing for your flat have been enclosed for your reference.
2. Select materials that you may choose to provide like tiles, sinks, CP and sanitary ware, etc. must be handed over at our site within 4 weeks of completion of brickwork and internal plastering.
3. Changes to external appearance and colour shall not be permitted. Changes to colour of doors/door frames in balcony/main entrance shall not be permitted. Change in colour of balcony walls shall not be permitted.
4. Fixing of grills & gates to the main door / balcony shall not be permitted.
5. Changes in walls, door positions or other structural changes shall not be permitted.
6. You may provide your own flooring tiles, bathroom tiles, CP & sanitary fittings and they shall be installed by us.
7. Additional shelves & lofts shall not be permitted.
8. Charges & refunds will be as follows:

No charge for:

1. Choice of two free colors for walls;
2. Choice of two/three combinations for bathroom tiles.

Non standard items to be supplied by the buyer & installed free of cost:

1. Hardware.
2. CP & Sanitaryware.
3. Flooring tiles
4. Kitchen platform - granite / marble.
5. Bathroom tiles.

Extra charges shall be payable for:

1. Extra electrical points / switch boards / sockets / switches.
2. Additional kitchen platform with granite & dado.
3. Rounding / polishing of granite platform.
4. Exhaust hole in bathroom/kitchen.

Refund / charges for upgrade or downgrade or substitutions shall be applicable for:


1. Kitchen & bathroom tiles.
2. Flooring tiles.
3. CP fittings.
4. Sanitaryware & bathtubs.
5. Doors & hardware.
6. Kitchen sink.
7. Civil work.
8. Electrical switches.
9. Kitchen platform

No refunds shall be made for:

1. Kitchen platform.
2. Civil work.



| | | |
|-------------------------------|------------------------|------------------------|
| Description | Direction | N |
| Plumbing plan
West Facing | BRGV | Project Name & Phase : |
| Modi Realty Genome Valley LLP | Prepared By : | Imran |
| Soham Modi | Approved By : | Soham Modi |
| N.T.S | Scale : | |
| Date : | 24.09.2021 | Promoted by |
| Modi Properties Pvt Ltd | Phone: +91-40-66335551 | |

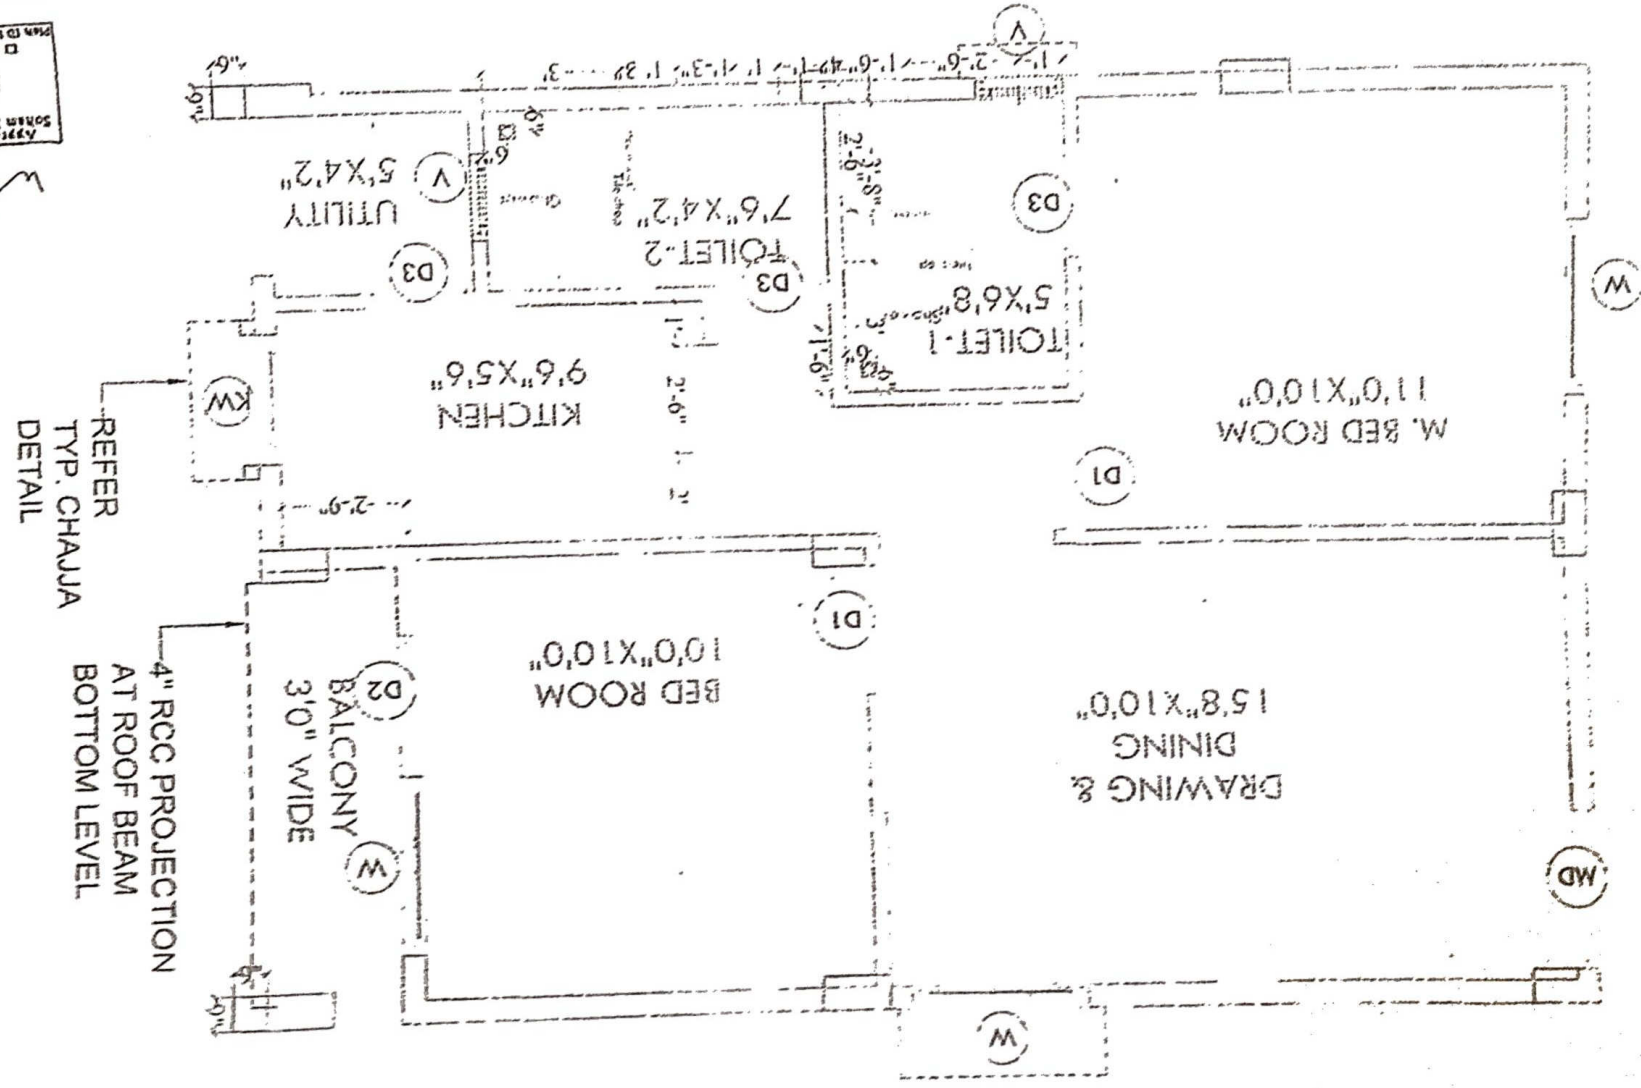


☐ Original
☐ Copy
 24 SEP 2021
 Approved for Construction
 Sohams Modi, Managing Director

ELECTRICAL PLAN

PLAN NO. 112, 114, 116, 118, 120 & 122

| Description | Direction | Owner & Developers | Date | Drawn by |
|-------------|-----------|---------------------------------|------------|------------|
| | N | Moat Realty Company, Valley LLP | 25.07.2001 | 25.07.2001 |
| | | Project Name & Phase: | | 25.07.2001 |
| | | Approved by: | | 25.07.2001 |
| | | Scale: | | 25.07.2001 |
| | | Sheet No.: | | 25.07.2001 |
| | | Sheet No.: | | 25.07.2001 |

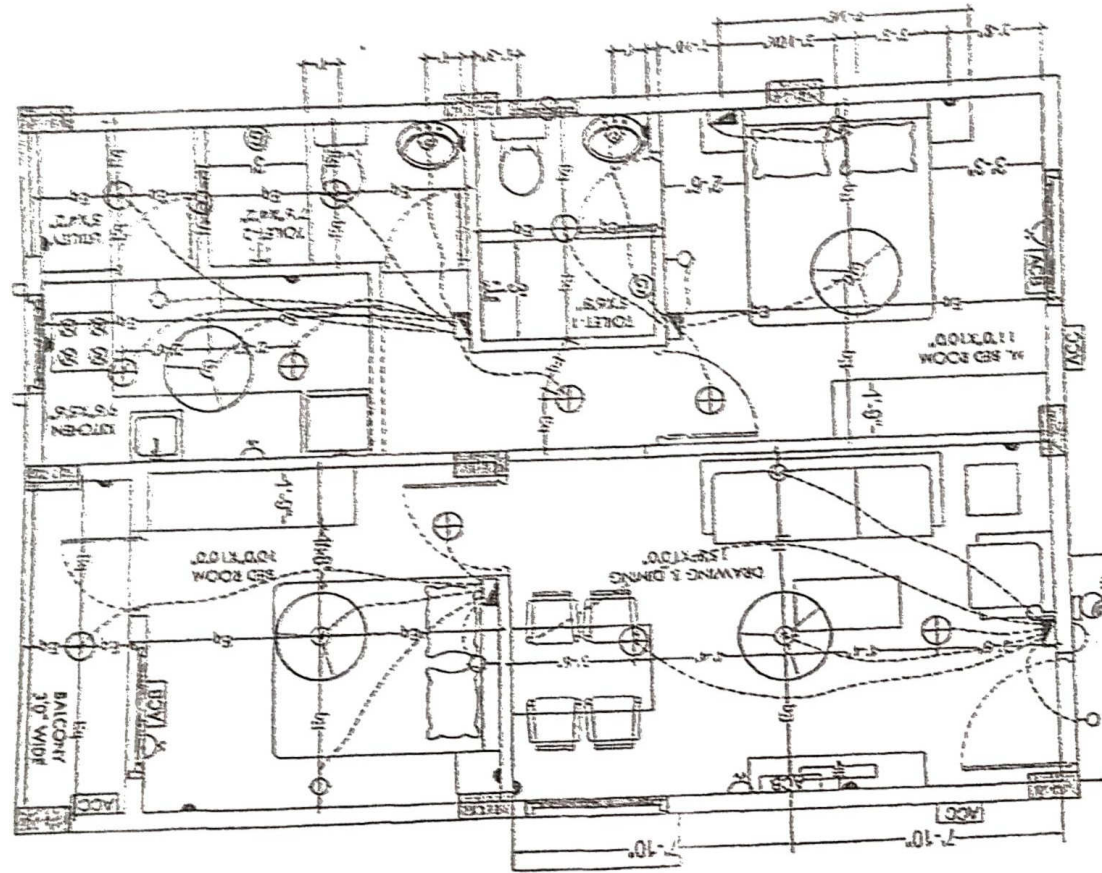

LEGEND:

| S. NO. | ITEM | SYMBOL |
|--------|-------------------|----------|
| 1. | Change over | (Symbol) |
| 2. | Switch | (Symbol) |
| 3. | One position lamp | (Symbol) |
| 4. | One position lamp | (Symbol) |
| 5. | One position lamp | (Symbol) |
| 6. | One position lamp | (Symbol) |
| 7. | One position lamp | (Symbol) |
| 8. | One position lamp | (Symbol) |
| 9. | One position lamp | (Symbol) |
| 10. | One position lamp | (Symbol) |
| 11. | One position lamp | (Symbol) |
| 12. | One position lamp | (Symbol) |
| 13. | One position lamp | (Symbol) |
| 14. | One position lamp | (Symbol) |
| 15. | One position lamp | (Symbol) |
| 16. | One position lamp | (Symbol) |
| 17. | One position lamp | (Symbol) |
| 18. | One position lamp | (Symbol) |
| 19. | One position lamp | (Symbol) |
| 20. | One position lamp | (Symbol) |

APPROVED FOR CONSTRUCTION
7 3 JUL 2001
ELECTRICAL ENGINEER

| | | | |
|-------------------------------|--|---|--|
| Description | | First Floor Typical Flat -
114,116,118,120 | |
| Owners & Developers : | | Direction
N | |
| Modi Realty Genome Valley LLP | | Project Name & Phase : | |
| Prepared By : Imran | | Scale : | |
| Approved By : Soham Modi | | N.T.S | |
| Date : 06.09.2021 | | Promoted by | |
| Modi Properties Pvt Ltd | | Phone: +91-40-66333551 | |

