

**MODI REALTY MALLAPUR LLP**

# 5-4-187/3&4, II Floor, M.G. Road,  
Secunderabad - 500 003.  
Phone : +91 - 40 - 66335551

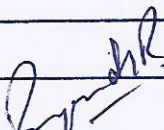
**GULMOHAR RESIDENCY**

Sy. No. 19, Mallapur,  
Hyderabad - 500 076.  
Phone : +91 91210 21818

Sl. No. **1009**Date : 14/12/2019

Inspection of first slab Block B' Flat NO. 425 C 101-011.  
Beams and Slab Reinforcement & Shuttering.

- ① RS beams fabrication is under progress.
- ② Top extra reinforcement in B3' in flat NO. 4 is missing.
- ③ Dood / Anchors have yet. Starters to be installed.
- ④ All top reinforcement of beams & slabs (main & extra) shall be bend @ end supports.
- ⑤ Provide column tie or beam stirrups @ beam column junctions.
- ⑥ Reinforcement for beams & slabs other than RS & B3 (mentioned above) are correct & as per structural drawings.
- ⑦ Complete all bar bending & shuttering works. Complete all rectification works. Provide chairs & cover blocks under reinforcement. Inform after completion of all works take approval & then proceed for concrete.

  
Engineer Sign.

Date : 14/12/19

  
Consultant Sign.  
Mohammed Ashemuddin  
Date :  
Zaki A Sivasubalan