

MODI REALTY MALLAPUR LLP

5-4-187/3&4, II Floor, M.G. Road,
Secunderabad - 500 003.
Phone : +91 - 40 - 66335551

GULMOHAR RESIDENCY

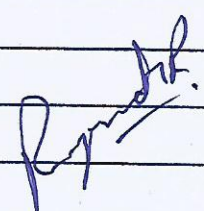
Sy. No. 19, Mallapur,
Hyderabad - 500 076.
Phone : +91 91210 21818

Sl. No. **1011**


Date : 09.01.2020.

- I Inspection of First slab between the grid A-0/1-3.
Beams and slab reinforcement & Shuttering.
- Beams top extra reinforcement B2 1-16mm is of using
 - Beams & slab reinforcement other than B2 is correct & as per structural drawings
 - Provide cham & cover blocks under reinforcement
 - Provide extension bars for column beams (longitudinal joint).
 - Close all shuttering gaps provide additional reinforcement 1-16mm in B2 & the proceed with concrete pouring.

- II Column C M/3, 0/3. Moved 3" from original center line. Check the location of columns with the architect if there is any change in the drawings (Arch). Send the same drawing to our office for structural changes.


Engineer Sign.

Date : 09/01/2020


Consultant Sign.

Mohammed Ashwath

Date :

Zaki Associates