

MODI REALTY MALLAPUR LLP

5-4-187/3&4, II Floor, M.G. Road,

Secunderabad - 500 003.

Phone : +91 - 40 - 66335551

GULMOHAR RESIDENCY

Sy. No. 19, Mallapur,

Hyderabad - 500 076.


Phone : +91 91210 21818

Sl. No. **1016**Date : 29.01.2020

- I Inspection of First slab of tower 'A' between the grid
~~A~~ B-0/10-15 beams & slab reinforcement and checking
 — Beams & slab reinforcement checked found
 correct & as per structural drawings.
 — Provide chains & cover blocks under reinforcement
 & then pour concrete.

- II Column alignment changed from one place
 to another.
 I Column C9/R4 ~~was at the same location~~
 line - projecting in open area instead of flat location.
 A Rearrange column @ 3rd slab by reducing
 size from ~~the~~ inside of flat.

- III See beam condition in driveway
 drain area. Paste surgical glass @
 deflection & center area of the beam
 keep it for 24 hrs - 48 hrs. The glass
 will break if there is any deflection.
 If deflection does not occur. Finish the
 beam to level.

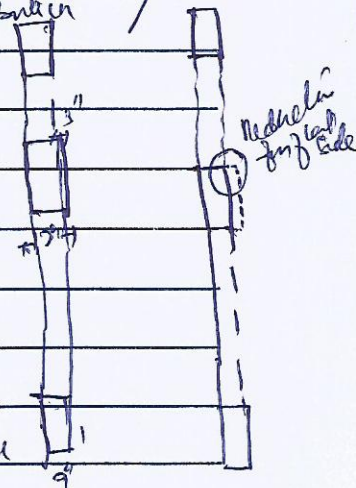

Engineer Sign.

Date : 29/01/2020

Consultant Sign.

A. Mohammed Ashraf

Date : 29/01/2020

2020/01/29