

Quality Control Check Report. Stage: After Plumbing & Electrical (Apartments)

Flat No.	A-418	Other	-	Sl. No.	41829
Company	M R G V	Project	B R G V	Phase	-
Prepared by	P. Bhargava	Sign	P.B.	Date	19-05-23
Project Manager	Sarwan	Sign	Syulgha	Date	19-05-23
Previous stage report no.	41609	Report filed and signed by PM?	☒ Yes ☐ No		
Additions & alterations sheet date	15/04/22	All pages signed by engineer & customer?	☒ Yes ☐ No		
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
- ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
- ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
- ☐ Proceed with further work. ATR not required.

Inspection should be done after:

- after cleaning the apartment.
- before starting painting, tiling & flooring.
- electrical conduct, waterproofing & plumbing work is completed (for stage II only).
- additions & alterations is finalized and signed. In case there are no additions and alterations printout of email by PM to CR confirming the same must be filed.
- additions & alterations sheets to be transferred to QC file. QC to check if A&A are made as per request.

After Plumbing & Electrical Check.

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✗ for minor mistake that requires minor correction.
3. Mark ✗✗ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✗✗✗ for major mistake that cannot be corrected.
5. Location of CPVC & PVC fittings must be checked as per measurements given in circular. Tolerance 1".
6. Location, height and spirit level of electrical points must be checked as per measurements given in circular & plan. Tolerance 1".
7. Civil work near pipes in balcony & utility must be neat and mortar should be removed from the pipes.
8. Water proofing must cover all pipes & check height above SFL.
9. Fasteners must be used as specified in circular. Especially check fixing of PVC pipes.
10. Height of DB box must be 6" below false ceiling level or 12" below slab level.
11. In case of many changes in civil work, electrical work and plumbing work, a new drawing must be prepared at HO and approved by MD.

Quality Control Check Report. Stage: After Plumbing & Electrical (Apartments)

S No	Room	Civil work near pipes in balcony & utility ⁷ (✓ or ✕)	CPVC & PVC Check ⁵ (✓ or ✕)	Electrical points check ⁶ (✓ or ✕)	Water proofing check ⁸ (✓ or ✕)	Proper use of fasteners check ⁹ (✓ or ✕)	Placement of DB ¹⁰ (✓ or ✕)	Placement of Generator changeover (✓ or ✕)
1	Bedroom 1 <i>M-Bed</i>	—	—	✓	—	—	—	—
2	Toilet 1 <i>M-Toi</i>	—	✓	✓	✓	✓	—	—
3	Bedroom 2 <i>K-Bed</i>	—	—	✓	—	—	—	—
4	Toilet 2 <i>C-Toi</i>	—	✓	✓	✓	✓	—	—
5	Bedroom 3	—	—	—	—	—	—	—
6	Toilet 3	—	—	—	—	—	—	—
7	Drawing	—	—	✓	—	—	✓	—
8	Dining	—	—	✓	—	—	—	—
9	Lobby 1	—	—	—	—	—	—	—
10	Utility / balcony 1	✓	✓	✓	✓	✓	—	—
11	Utility / balcony 2	✓	✓	✓	—	✓	—	—
12	Utility / balcony 3	—	—	—	—	—	—	—
13	Kitchen	—	✓	✓	—	—	—	—
14	Other							
15	Other							
Remarks <i>1) Utility nahini trap not as per specification's, Hole packing not done in M-Toi</i>								
Remarks on additions & alteration sheet:								
Signed by engineer,		☐ Yes ☒ No		Signed by customer,		☒ Yes ☐ No		
Revised drawing required from HO		☐ Yes ☐ No		Approved revised drawing attached		☐ Yes ☐ No		

Quality Control Check Repot. **Stage: After Plumbing & Electrical (Apartments)**

Miscellaneous check

Screeding done on walls upto 12" outside bathroom/utility	☒ Yes ☐ No
Bathroom /utility filled with 4" water for water proof check	☐ Yes ☒ No
Hole packing done around all pipes in ceiling and internal walls	☒ Yes ☐ No
Remarks:	

Quality Control Check Report. Stage: After Finishing Stage II (Apartments)

Flat No	A-418	Other	-	Sl. No.	42106
Company	M R G V	Project	BRGV	Phase	-
Prepared by	P-Bhaxath	Sign	<i>[Signature]</i>	Date	27-07-23
Project Manager	Saxwax	Sign	<i>[Signature]</i>	Date	27-07-23
Previous stage report no.	41829	Report filed and signed by PM	☒ Yes ☐ No		
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
- ☒ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
- ☐ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
- ☐ Proceed with further work. ATR not required.

Inspection should be done after:

- Completion of flooring, bathroom /utility tiles, first coat of paint.
- Completion of doors, windows, grills, electrical wiring, switches must be done in next stage
- False ceiling must be completed before flooring.
- Kitchen platform, granite and dado must be completed where modular kitchen is not provided.
- Provide granite soffit for main door and balconies in this stage.

Miscellaneous check:

Main door fixed with lock & stopper	☒ Yes ☐ No		
Granite soffit for balcony required	☐ Yes ☒ No	Granite soffit for balcony provided	☐ Yes ☐ No
Balcony granite soffit workmanship	☐ Good ☐ Avg ☐ Poor	Balcony granite soffit edge polishing	☐ Good ☐ Avg ☐ Poor
Granite soffit for main door required	☐ Yes ☒ No	Granite soffit for main door provided	☐ Yes ☐ No
Main door granite soffit workmanship	☐ Good ☐ Avg ☐ Poor	Main door granite soffit edge polishing	☐ Good ☐ Avg ☐ Poor

Quality Control Check Repot. Stage: After Finishing Stage II (Apartments)

Tiling & granite work		Rate the quality of (Good ✓, Avg. ✕, Poor – needs correction ✕✕, NA)												
S No	Room	Workmanship of tiling	White cement filling around CPVC lines	Corners finishing	Finishing near doors	Finishing on top of tiles	Finishing near ventilators	Step at bathroom entrance / utility	Step for shower / pot wash	Tile joint grouting	Granite platform finishing and edge polishing	Granite platform slope	Granite platform height	Finishing under granite platform
1	Toilet-1 M-Toi	✓	✕✕	✓	-	✓	-	✓	✓	-	✓	-	-	-
2	Toilet-2 C-Toi	✓	✕✕	✓	-	✕	-	✓	✓	-	-	-	-	-
3	Toilet-3	-	-	-	-	-	-	-	-	-	-	-	-	-
4	Toilet-4	-	-	-	-	-	-	-	-	-	-	-	-	-
5	Wash basin in dining area	-	-	-	-	-	-	-	-	-	-	-	-	-
6	Kitchen	✓	-	✓	-	✓	-	-	-	-	✓	✓	✓	✕✕
7	Utility	✓	✕✕	✓	-	✕	-	-	-	-	-	-	-	-
8	Other													
9	Other													

Remarks

1) Finishing near ventilators was poor. 2) Grouting work's to be improved in the flat. 3) In utility Rod's to be cut. 4) Finishing near door for C-Toi, M-Toi To be improved. 5) level of M-Toi Tiles was poor.

Quality Control Check Repot. Stage: After Finishing Stage II (Apartments)

Flooring & painting		Rate the quality of (Good ✓, Avg. ✕, Poor – needs correction ✕✕, NA)												
S No	Room	Color variation of floor tiles	Flooring workmanship & grouting	Skirting size (3")	Skirting workmanship	Plastering above skirting	Plastering & finishing of walls	Crack filling	Loft Finishing	Windows check	General quality of painting & finishing	Door & frame painting quality	Door beading, luppam and painting quality.	Edge building
1	Bedroom 1 M. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✕	✓	✓	✓	✓
2	Bedroom 2 K. Bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✕
3	Bedroom 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
4	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✕	✓	✓	✓	✓
5	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✕
6	Lobby 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Utility / balcony 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Utility / balcony 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✕
9	Utility / balcony 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
10	Kitchen	✓	✓	✓	✓	✕✕	✓	✕	✓	✕	✓	✓	✓	✕
11	Other													
12	Other													
Remarks		1) Finishing near K. Bed window to be done., finishing near K. Bed door, M. Bed door to be improved. 2) In couple of Room's Tiles Hollow sound is coming.												

Quality Control Check Report. Stage: After Brickwork (Apartments/ Lab Spaces)

Flat No.	A-418	Others	-	Sl. No.	41330
Company	M R G V	Project	B R G V	Phase	-
Prepared by	K. Snela	Sign	Snela	Date	15-02-2023
Project Manager	Saurav/Abhishek	Sign	Abhishek	Date	15-02-2023
Previous Stage report no.	40334	Report filed and signed by PM?		☒ Yes ☐ No	
Apartment No.		Other		other	
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No
Recommendation: ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC. ☒ Stop further work. Proceed with work after submitting ATR on QC report to QC team. ☐ Proceed with further work only after making corrections pointed out in the QC report. ATR not required. ☐ Proceed with further work. ATR not required.					

Inspection should be done after:

- brickwork is completed
- chicken mesh fixed
- after cleaning the apartment
- electrical conducting work is completed

Brickwork Check.

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✕ for minor mistake that requires minor correction.
3. Mark ✕✕ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✕✕✕ for major mistake that cannot be corrected.
5. Wall thickness should be as per plan. Use of 4", 6" & 8" blocks must be checked.
6. All walls should have 2 beds of about 2" to 3" thickness with one no. 6 mm or 8 mm rod with M15 CC.
7. Chicken mesh should be used in each and every joint between RCC & Brickwork.
8. Joint between brickwork & beam on external side must be filled.
9. Check room dimensions with working plan. (Tolerance: 1")
10. Diagonals of each room shall be equal. (Tolerance: 2")
11. Balcony sill level should be 3'3" from SFL. (Tolerance: 1")
12. Check room height with specified height. (Tolerance: 1")
13. Check plumb of walls wherever it appears to be out of plumb. (Tolerance: 1/2")
14. Specify the No. of beams which are not aligned by more than 1" in a room.
15. Door frames must have black Japan coating and wood primer / pellambar – at cost of painter.

Quality Control Check Report. Stage: After Brickwork (Apartments/ Lab Spaces)

S No	Room	Wall thickness (✓ or ✕)	Beds in walls (✓ or ✕)	Chicken mesh (✓ or ✕)	External brickwork & beam joint (✓ or ✕)	Room Dimensions (✓ or ✕)	Room Dimensions Difference in inches	Diagonal (✓ or ✕)	Diagonal Difference in inches	Balcony sill level (✓ or ✕)	Room Height (✓ or ✕)	Plumb of walls (Good/Avg./Bad)	Alignment of beams and walls - Nos.
1	Bedroom 1 m.bed	✓	✓	✓	✕	✓	-	✓	-	-	✓	Avg	✓
2	Toilet 1 m.Toi	✓	✓	✕	✕	✓	-	✓	-	-	✓	"	✓
3	Bedroom 2 K.bed	✓	✓	✓	✕	✓	-	✓	-	-	✓	"	✓
4	Toilet 2 C.Toi	✓	✓	✓	✕	✓	-	✓	-	-	✓	"	✓
5	Bedroom 3	-	-	-	-	-	-	-	-	-	-	-	-
6	Toilet 3	-	-	-	-	-	-	-	-	-	-	-	-
7	Drawing	✓	✓	✓	✕	✓	-	✓	-	-	✓	Avg	✓
8	Dining	✓	✓	✓	✕	✓	-	✓	-	-	✓	"	✓
9	Lobby 1	-	-	-	-	-	-	-	-	-	-	-	-
10	Utility / balcony 1	✓	✓	✓	✕	✓	-	✓	-	-	✓	Avg	✓
11	Utility / balcony 2	✓	✓	✕	✕	✓	-	✓	-	-	✓	"	✓
12	Utility / balcony 3	-	-	-	-	-	-	-	-	-	-	-	-
13	Kitchen	✓	✓	✕	✕	✓	-	✓	-	-	✓	Avg	✓
14	Other												
15	Other												
Remarks		Note 1. In m.Toi, Utility & Kitchen chicken mesh was not provided.											

Quality Control Check Repot. Stage: After Brickwork (Apartments/ Lab Spaces)

Quality of edges and corners in all rooms?	☐ Good ☒ Avg. ☐ Bad
Specify rooms that need correction:	

Misc. Checks.

Was 3.75 CFT proportion box provided?	☒ Yes ☐ No
Condition of proportion box?	☐ Good ☒ Avg. ☐ Bad
Was the Apartment cleaned before starting brick work?	☐ Yes ☐ No ☒ Cant' say
Is the Apartment cleaned for plastering?	☒ Yes ☐ No
Wastage?	☐ High ☒ Medium ☐ Low
Storage of building material like bricks sand and cement.	☐ Good ☒ Avg. ☐ Bad
Drum (200 ltrs) provided for curing in each flat?	☒ Yes ☐ No
Remarks:	

Door Frames & Windows check

Notes:

1. Mark ✓ for correct or minor mistake which does not require correction
2. Mark ✕ for minor mistake that requires minor correction.
3. Mark ✕✕ for major mistake that requires correction by replacement or re-fixing.
4. Mark ✕✕✕ for major mistake that cannot be corrected.
5. Window template depth should be between 2 to 2 ½" after plastering
6. Lintel level should be 7'3" from SFL & 7' from FFL. (Tolerance 1"). Lintel should be as per standard design.
7. Lofts should be at a height of 7' to 7'3" from FFL. Kitchen platform thickness should be 2", SFL to bottom 31" (Tolerance 1")
8. Slopes of lofts and kitchen platforms to be checked by using 12" spirit level and check height from floor from 2 or 3 points.
9. Thickness of platforms & lofts should be between 2 & 2.5".
10. Provide single layer table brick at bottom of each door frame without threshold.
11. Check Z angle template size (Z angle for bathroom ventilators not required in new projects).
12. Window opening must be checked with MS square pipe templates of 2 sizes for inner and outer openings.
13. Z angle template must be 1" from brick wall surface from the inner side.

Quality Control Check Report. Stage: After Brickwork (Apartments/ Lab Spaces)

S No	Room	Door size, face and position (✓ or ✗)	Brick at bottom of door frame (✓ or ✗)	Door frame hold fast provision and fasteners. (✓ or ✗)	Door lintel design & level (✓ or ✗)	Door diagonal check (✓ or ✗)	Door Plumb - two sides (✓ or ✗)	Windows lintel design & level. Sill level (✓ or ✗)	Windows size (✓ or ✗)	Windows - template depth & diagonal (✓ or ✗)	Windows - template red oxide painting (✓ or ✗)	Loft & Kitchen platform height (✓ or ✗)	Loft & Kitchen platform slope (✓ or ✗)	Door size, face and position (✓ or ✗)
1	Bedroom 1 m.bed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
2	Toilet 1 m.Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
3	Bedroom 2 K.bed	XX	✓	✓	✓	✓	✓	XX	XX	XX	✓	✓	✓	✓
4	Toilet 2 c.Toi	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
5	Bedroom 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
6	Toilet 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
7	Drawing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
8	Dining	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
9	Lobby 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
10	Utility / balcony 1	XX	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
11	Utility / balcony 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
12	Utility / balcony 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
13	Kitchen	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
14	Other													
15	Other													
Remarks:		Note: 1. In K.bed 4 balcony door frames was not provided												
		2. In K.bed Z - Angle not provided.												
		3. Kitchen platform was not casted.												
		4. Loft hacking was not done.												

Quality Control Check Report. Stage: After Finishing Stage III (Apartments)

Flat No	A-418	Other	—	Sl. No.	42527
Company	MRGV	Project	BRGV	Phase	—
Prepared by	P. Bharath	Sign	<i>[Signature]</i>	Date	30-10-23
Project Manager	Sarwar	Sign	<i>[Signature]</i>	Date	30-10-23
Previous stage report no.	42106	Report filed and signed by PM		☒ Yes ☐ No	
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No

Recommendation:

- ☐ Stop further work. Submit ATR on QC report to QC team. Proceed only after recheck by QC.
- ☐ Stop further work. Proceed with work after submitting ATR on QC report to QC team.
- ☒ Proceed with further work only after making corrections pointed out in the QC report. ATR not required.
- ☐ Proceed with further work. ATR not required.

Inspection should be done after :

- Completing stage II works.
- Complete works like doors, windows, grills, electrical wiring, switches, french door glass, etc.
- In case of modular kitchen provide platform, granite and dado and modular kitchen in this stage.
- Provide video door phone in this stage.
- Possession for wood work cannot be given until QC check for stage III is completed and all corrections mentioned in the report are made.



Miscellaneous check:

Modular kitchen to be provided	☐ Yes ☒ No	Modular kitchen provided	☐ Yes ☐ No —
Modular kitchen workman ship	☐ Good ☐ Avg ☐ Poor	Modular kitchen granite & dado workman ship & finishing	☐ Good ☐ Avg ☐ Poor —
Video door phone /wifi cam to be provided	☒ Yes ☐ No	Video door phone/wifi cam provided	☐ Yes ☒ No
Painting marks and drops are cleaned from floor, windows, walls.		☐ Good ☒ Avg ☐ Poor	

Quality Control Check Report. Stage: After Finishing Stage III (Apartments)

		Rate the quality of (Good ✓, Avg. ✗, Poor – needs correction ✗✗, NA)											
S No	Room	Door, door knob & door stopper fitting	Door, door knob & door stopper cleaning	Window grills & quality	Window grills fitting & finishing	Windows quality	Window fitting & finishing	Balcony railing quality & finishing	French door quality & fitting	CP jali quality and fitting	Edge building	Switch boards fitting & covering with plastic covers	Junction box covers painting
1	Bedroom 1 M- Bed	✓	✓	✓	✓	✓	✓	-	-	-	✓	✓	✓
2	Bedroom 2 K- Bed	✓	✓	✓	✗	✓	✗✗	-	-	-	✗	✓	✓
3	Bedroom 3	-	-	-	-	-	-	-	-	-	-	-	-
4	Drawing	✓	✓	✓	✓	✓	✓	-	-	-	✗	✓	✓
5	Dining	-	-	-	-	-	-	-	-	-	✓	✓	✓
6	Lobby 1	-	-	-	-	-	-	-	-	-	-	-	-
7	Utility / balcony 1	✓	✓	✓	✓	-	-	-	-	✓	✓	✓	✗
8	Utility / balcony 2	✓	✓	-	-	-	-	✓	-	✓	✓	✓	✓
9	Utility / balcony 3	-	-	-	-	-	-	-	-	-	-	-	-
10	Kitchen	-	-	✓	✓	✓	✓	-	-	-	✓	✓	✓
11	Toilet 1 M- Toi	✓	✓	✓	✗	✓	✓	-	-	✓	✗	✗	✓
12	Toilet 2 C- Toi	✓	✓	✓	✗	✓	✓	-	-	✓	✗	✓	✗
13	Toilet 3	-	-	-	-	-	-	-	-	-	-	-	-
14	Other												
15	Other												
Remarks		1) In drawing Rool to be cut. 2) Sillicon finishing near K.B window 3) In couple of Room's grouting work to be improved. 4) Balcony door finishing was to be improved.											

Check report by Sales + CR after finishing stage IV (Apartments)

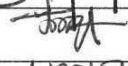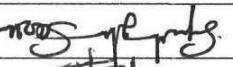Flat No	418	Other		SI. No.	43170
Company	MRCV LLP	Project	BKAY	Phase	
Prepared by	Venkat Reddy	Sign		Date	7/10/24
Project Manager	Sarvesh	Sign		Date	
Stage II report no.					
Checked By MD on		MD Sign		For filling	☐ Yes ☐ No
Recommendation: ☐ Work is satisfactorily completed. Possession may be handed over. ☒ Minor corrections given herein to be completed before handing over possession. ☐ Major corrections required. Do not handover possession. Request for recheck after completion of works. ☐ Works incomplete. Check report cannot be prepared. Request for recheck after completion of works.					

Notes:

- Site to make request for stage IV inspection on M-codex. QC to forward request by email to Sales/CR manager with SI No. generated by M-codex.
- Inspection to be carried out with one member of sales team and CR team + site engineer within 3 days of request.
- Site engineer shall ensure that all works are completed and the Flat is thoroughly cleaned in all respects before requesting for inspection.
- Possession cannot be handed over to customer without this inspection.
- Report to be made on same day. Scanned copy to be sent to CR for uploading. Original to be sent to Ashaiya.
- Mark green tick if work is completed. Red 'x' if minor corrections are required. Red 'xx' if work not completed/needs major corrections. Mark 'NA' if not applicable.


7/11/24

Check report by Sales + CR after finishing stage IV (Apartments)

Miscellaneous check (check for quality & completion):

Modular kitchen	N/A	Security camera provided	No
Main door soffit quality	✓	False ceiling provided by developer	N/A
No material is stored in flat	✓	Properly labelled keys – 3 sets	✓
Loft tank installed in utility	✓	Kitchen granite platform and dado	✓
Loft provided	✓	Loft finishing	✓
Water supply	✓	Electricity supply	✓
Generator backup (auto)	✓	Car parking provided	✓
Flat label	✓	Car parking label	✓
Provision of lift	✓	Cleanliness of corridors + staircase	✓
Remarks:			

Check report by Sales + CR after finishing stage IV (Apartments)

S No	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15
Room/ quality check	Bedroom 1	Bedroom 2	Bedroom 3	Drawing	Dining	Lobby 1	Utility / balcony 1	Utility / balcony 2	Utility / balcony 3	Kitchen	Toilet 1	Toilet 2	Toilet 3	Other:	Other:
	Floor & wall tiles	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Painting	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
	Doors + hardware + door beading	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
Windows/ventilator + grill + hardware	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
Electricals – switches, switch boards, points	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
CP & sanitary fittings									✓	✓	✓		✓		
Ratings															
Painting of exposed pipes + hole packing	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
Air cracks are treated and painted	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
Seepages (Nil)	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✗	✓	✓		
Cleanliness /removal of paint spots	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		

BLOOMDALE

Residency @ Genome Valley

Shamirpet, Hyderabad

Site Office : Ss. No. 31 & 32, Muraharipally,

Medchal Mandal, Hyderabad - 500 078

☎ : +91-91210 21717 E-J : bngv@modiproperties.com

Developed by : M/s. Bloomdale Residency Genome Valley LLP.



Head Office: 5-4-187/3&4, II Floor, M. G. Road,

Secunderabad - 500 003. ☎ +91 40663 35551,

✉ info@modiproperties.com www.modiproperties.com

Details of Additions & Alterations

Flat No	418	Type	Deluxe / Semi-Deluxe
Buyer Name	Lakshmi Rajyam. P		
Phone No.	9298153564	Email	plrajyam1963@gmail.com

I hereby confirm that I have given the details of the minor additions and alterations that are required in the above referred flat in the pages attached herein. Please complete the changes suggested by me. I agree to pay the charges, if any, for the additions and alterations that I have asked you to make, as per the rates suggested by you. I shall deliver all the materials that are required to be provided by me at the site on or before _____ In case I fail to deliver these items to the site by the specified date, you may complete the works in the flat as per the standard items provided by you.

Buyers sign		Engg. Sign	
Date:	15/4/22	Date	15/4/22

Note:

1. Colour shades of paints may vary from batch to batch & company to company. The Builder will not take responsibility of quality of work for dark shades especially green & blue.
2. Shade / colour of natural material like marble and granite can't be guaranteed and may vary from lot to lot. Cracks like appearance in marble is a natural feature and Builder shall not be responsible for repairs or replacement.
3. Availability of bathroom or flooring tiles of the same type /colour/make can not be guaranteed and closest possible type/colour/make may be used in its place.
4. No further change shall be permitted from this day.
5. Please sign on all pages.

Notes of lectures

no chaps.

1,

Changes in flooring:

no chaps.

1,

1,

ges in electrical points: (mark on plan)

① 16 Amp Rcd.

② 16 Amp Rcd.

/

voice of Bathroom tiles, CP fittings & Sanitary ware:

No change.

/

Changes in kitchen platform: (mark on plan)

No change.

/

/

Details of solar water heater:

Other Changes:

10

Mrs. Peddiraju Lakshmi Rajyam,
W/o Mr. Surabhi Venkata Subramanya,
H. No.6-2-16, Near Ayyappa Swamy Temple,
Kanteshwar, Subhashnagar, Nizamabad-503002

Dear Sir/ Madam,

If you wish to make any minor additions or alterations to the flat that you have booked, we request you to visit the site during office hours between 05-03-2022 & 03-04-2022. We also request you to finalize details like color of walls, etc., during your visit to the site. Our site engineers will make note of these details.

For your convenience we request you to take prior appointment so that our engineers can give you their undivided attention. You may contact Mr.O.Sobhan Babu (Asst. Project Manager) on +91-9100036740 or Ms. Pusalatha (Asst. Engineer) on +91-9848942990 or by email at brgv_const@modiproperties.com

In case you fail to contact us during the above mentioned period, we shall assume that no changes are required, and your flat will be completed as per the standard specifications shown in the model flat.

Thank You.

Yours Sincerely,

For ~~Modi Realty~~ Genome Valley LLP.



~~Authorised Signatory.~~

Please refer to the notes attached herein.

1. Working drawings, electrical layout & plumbing drawing for your flat have been enclosed for your reference.
2. Select materials that you may choose to provide like tiles, sinks, CP and sanitary ware, etc. must be handled over at our site within 4 weeks of completion of brickwork and internal plastering.
3. Changes to external appearance and colour shall not be permitted. Changes to colour of doors/door frames in balcony/main entrance shall not be permitted. Change in colour of balcony walls shall not be permitted.
4. Fixing of grills & gates to the main door / balcony shall not be permitted.
5. Changes in walls, door positions or other structural changes shall not be permitted.
6. You may provide your own flooring tiles, bathroom tiles, CP & sanitary fittings and they shall be installed by us.
7. Additional shelves & lofts shall not be permitted.
8. Charges & refunds will be as follows:

No charge for:

1. Choice of two free colors for walls;
2. Choice of two/three combinations for bathroom tiles.

Non standard items to be supplied by the buyer & installed free of cost:

1. Hardware.
2. CP & Sanitaryware.
3. Flooring tiles
4. Kitchen platform - granite / marble.
5. Bathroom tiles.

Extra charges shall be payable for:

1. Extra electrical points / switch boards / sockets / switches.
2. Additional kitchen platform with granite & dado.
3. Rounding / polishing of granite platform.
4. Exhaust hole in bathroom/kitchen.


Refund / charges for upgrade or downgrade or substitutions shall be applicable for:

1. Kitchen & bathroom tiles.
2. Flooring tiles.
3. CP fittings.
4. Sanitaryware & bathtubs.
5. Doors & hardware.
6. Kitchen sink.
7. Civil work.
8. Electrical switches.
9. Kitchen platform

No refunds shall be made for:


1. Kitchen platform.
2. Civil work.

Description	First Floor Typical Flat - 114,116,118,120
Direction	N
Owners & Developers	Modi Realty Genome Valley LLP
Prepared By	Linnam
Approved By	Soham Modi
Scale	N.T.S
Promoted By	Modi Properties Pvt Ltd
Date	06.09.2021
Phone	+91-40-66335581

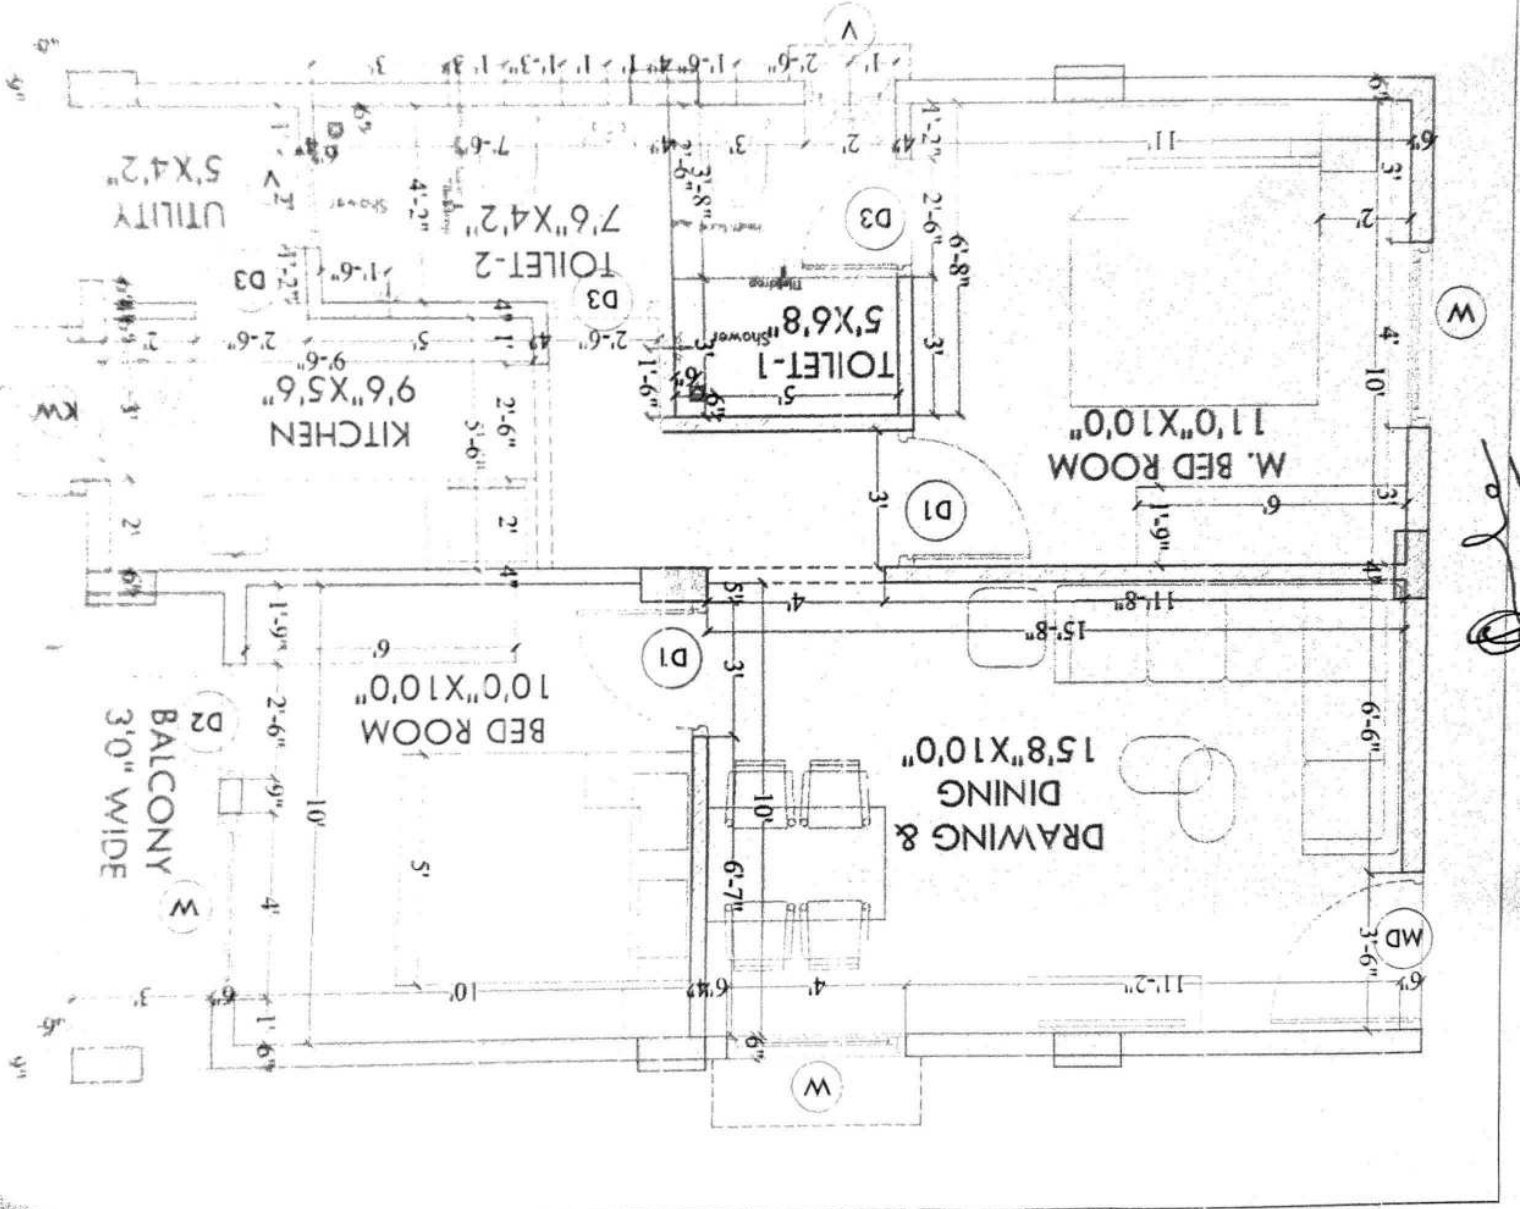


Description	Direction	Owners & Developers :	Date :	24.09.2021	Promoted by
		Modi Realty Cienome Valley LLP	Prepared By :	Imran	Modi Properties Pvt Ltd
Plumbing plan west Facing		Project Name & Phase :	Approved By :	Schmm Modi	Phone +91-40-66115551
		BRGV	Scale :	N.T.S	

Approved for Construction
 30th Sept, Managing Director
 24 SEP 2021
☐ Original ☐ Copy

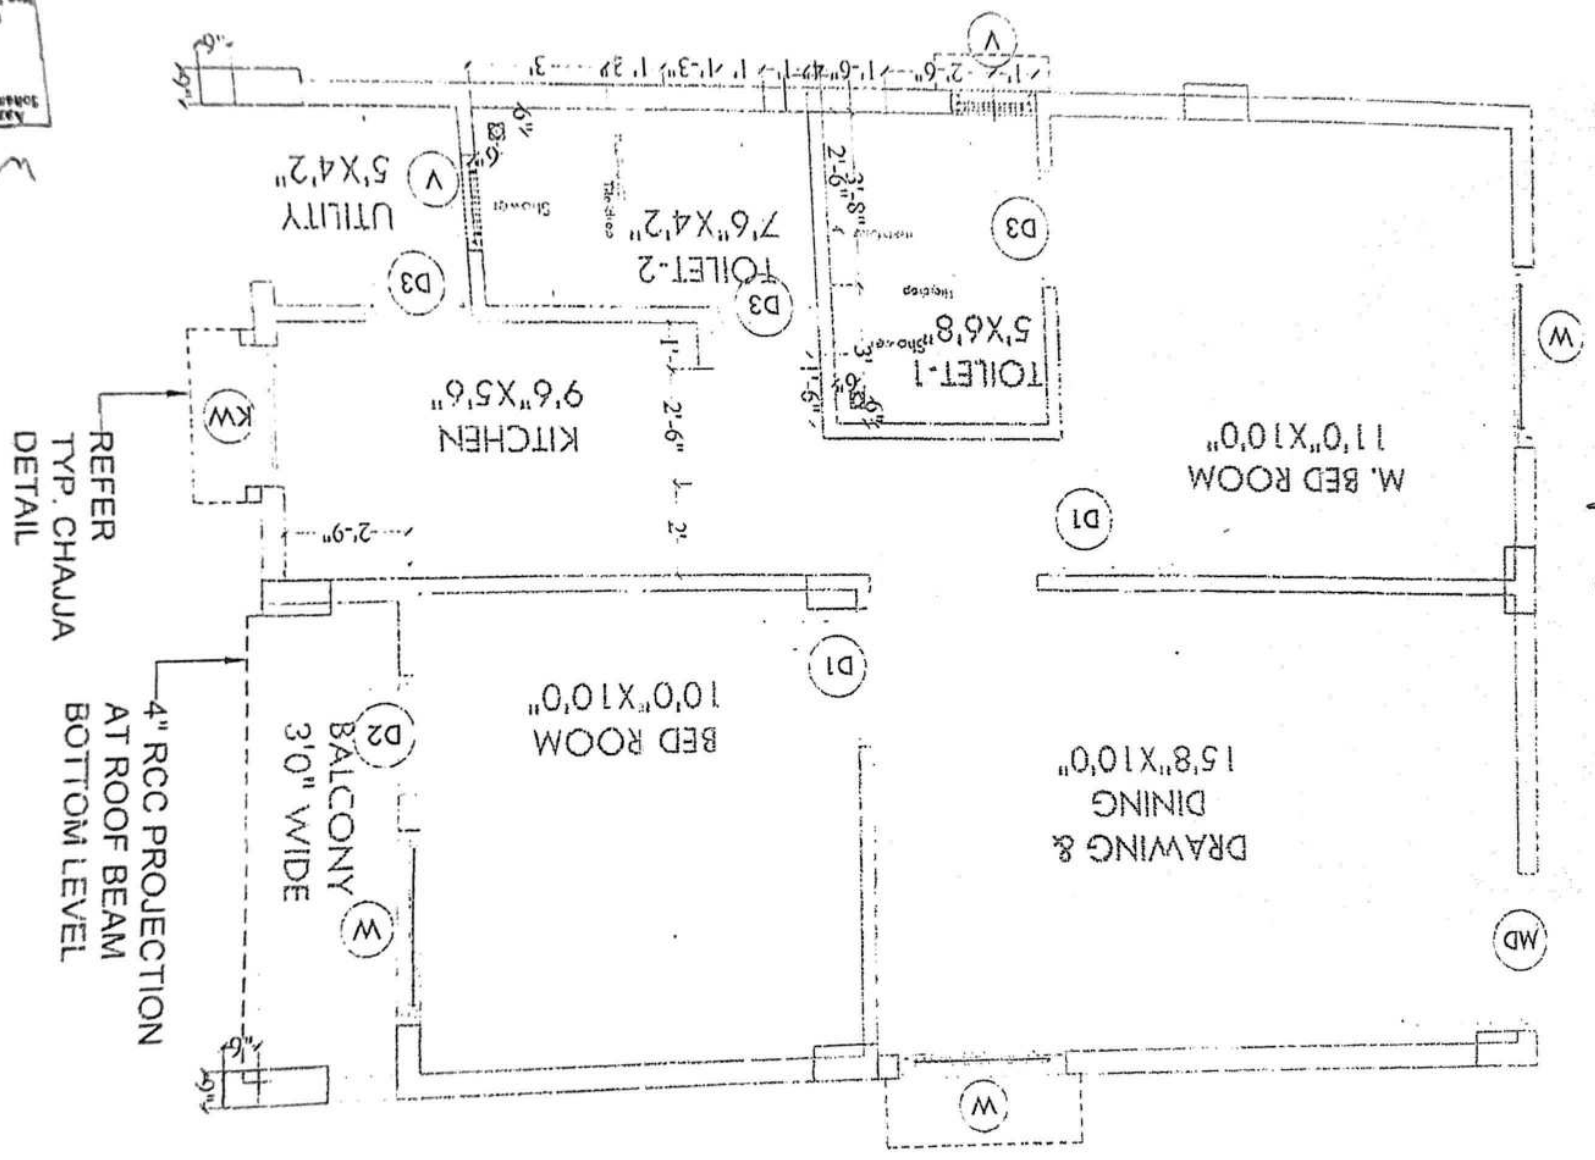

Description		Direction	Owners & Developers :	Date :	23.07.2021	Prepared By :	23.07.2021	Approved By :	Scale :	Project Name & Phase :	BRGV	Modi Properties Pvt. Ltd.	Phone +91-40-2033333
ELECTRICAL PLAN		N	Modi Realty Genome Valley LLP	Prepared By :	23.07.2021	Approved By :	23.07.2021	Approved By :	Scale :	Project Name & Phase :	BRGV	Modi Properties Pvt. Ltd.	Phone +91-40-2033333
FLAT NOS. 112, 114, 116, 118, 120 & 122													

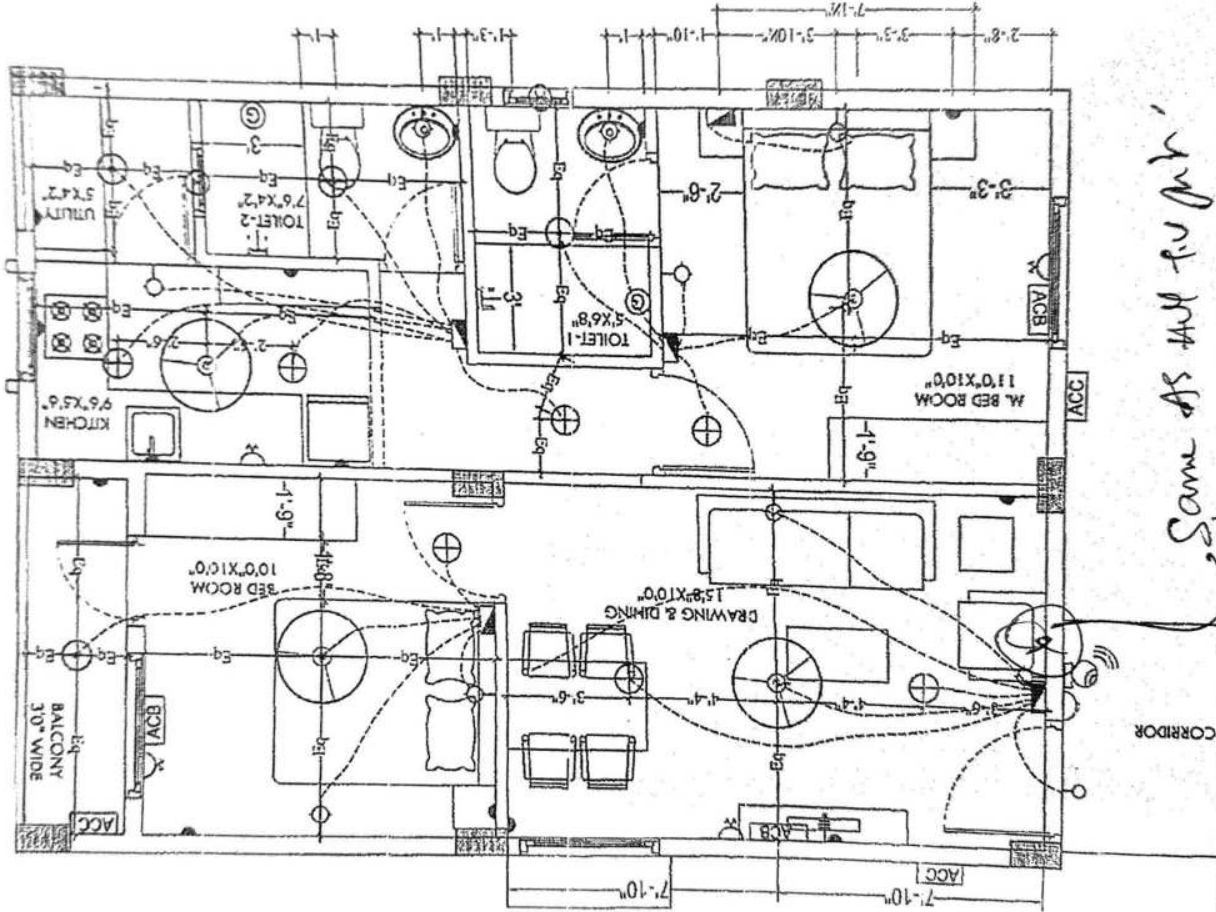

Same as all the plan
Etc.

LEGEND:

S. NO.	ITEM	SYMBOL	DESCRIPTION
1.	Disconnection Board & Switch	(Symbol)	Disconnection Board & Switch
2.	Bed room	(Symbol)	Bed room
3.	Wall point/switch/light	(Symbol)	Wall point/switch/light
4.	5 wires plug point	(Symbol)	5 wires plug point
5.	Ceiling fan	(Symbol)	Ceiling fan
6.	Carpet door lock	(Symbol)	Carpet door lock
7.	Carpet fan	(Symbol)	Carpet fan
8.	5 wires plug point	(Symbol)	5 wires plug point
9.	5 wires plug point	(Symbol)	5 wires plug point
10.	5 wires plug point	(Symbol)	5 wires plug point
11.	5 wires plug point	(Symbol)	5 wires plug point
12.	5 wires plug point	(Symbol)	5 wires plug point
13.	5 wires plug point	(Symbol)	5 wires plug point
14.	5 wires plug point	(Symbol)	5 wires plug point
15.	5 wires plug point	(Symbol)	5 wires plug point
16.	5 wires plug point	(Symbol)	5 wires plug point
17.	5 wires plug point	(Symbol)	5 wires plug point
18.	5 wires plug point	(Symbol)	5 wires plug point
19.	5 wires plug point	(Symbol)	5 wires plug point
20.	5 wires plug point	(Symbol)	5 wires plug point

7 JUL 2021
SOMAN MOOK
MANAGING DIRECTOR